

# Agilent N9320A Spectrum Analyzer

**User's Guide** 



### **Notices**

© Agilent Technologies, Inc. 2006

No part of this manual may be reproduced in any form or by any means (including electronic storage and retrieval or translation into a foreign language) without prior agreement and written consent from Agilent Technologies, Inc. as governed by United States and international copyright laws.

#### **Manual Part Number**

N9320-90001

#### Edition

Second Edition, March, 2008

Printed in China

Agilent Technologies, Inc. Hi-Tech Industrial Development Zone (West District) Chengdu 611731, P.R.C

### **Software Revision**

This guide is valid for A.02.00 revisions of the Agilent N9320A Spectrum Analyzer software.

#### Warranty

The material contained in this document is provided "as is," and is subject to being changed, without notice, in future editions. Further, to the maximum extent permitted by applicable law, Agilent disclaims all warranties, either express or implied, with regard to this manual and any information contained herein, including but not limited to the implied warranties of merchantability and fitness for a particular purpose. Agilent shall not be liable for errors or for incidental or consequential damages in connection with the furnishing, use, or performance of this document or of any information contained herein. Should Agilent and the user have a separate written agreement with warranty terms covering the material in this document that conflict with these terms, the warranty terms in the separate agreement shall control.

### **Technology Licenses**

The hardware and/or software described in this document are furnished under a license and may be used or copied only in accordance with the terms of such license.

### **Restricted Rights Legend**

U.S. Government Restricted Rights. Software and technical data rights granted to the federal government include only those rights customarily provided to end user customers. Agilent provides this customary commercial license in Software and technical data pursuant to FAR 12.211 (Technical Data) and 12.212 (Computer Software) and, for the Department of Defense, DFARS 252.227-7015 (Technical Data - Commercial Items) and DFARS 227.7202-3 (Rights in Commercial Computer Software or Computer Software Documentation).

#### **Safety Notices**

### **CAUTION**

A CAUTION notice denotes a hazard. It calls attention to an operating procedure, practice, or the like that, if not correctly performed or adhered to, could result in damage to the product or loss of important data. Do not proceed beyond a CAUTION notice until the indicated conditions are fully understood and met.

### WARNING

A WARNING notice denotes a hazard. It calls attention to an operating procedure, practice, or the like that, if not correctly performed or adhered to, could result in personal injury or death. Do not proceed beyond a WARNING notice until the indicated conditions are fully understood and met.

### In This User's Guide...

This guide contains operation information for the N9320A Spectrum Analyzer. The following are descriptions of the chapters within this book.

#### 1 Overview

A description of the front and rear panels.

### 2 **Getting Started**

Unpacking and setting up the analyzer.

### 3 Functions and Measurements

How to use the basic applications of the analyzer.

### 4 Key Reference

Front-panel hardkey descriptions and the related softkeys menu functions.

#### 5 One-Button Measurements

Key definition of one-button measurements.

### 6 Instrument Messages

Descriptions of the instrument messages of the analyzer.

### 7 In Case of Difficulty

Information and tips on what to do when instrument difficulties are encountered.

### 8 Menu Maps

Menu maps, the structure of the menus and what the user will see when making instrument parameter selections.

For more information about N9320A Spectrum Analyzer, see www.agilent.com/find/n9320a.

# **Contents**

1	Overview 1	
	Agilent N9320A at a Glance 2	
	Front Panel Overview 4	
	Rear Panel Overview 9	
	Front and rear panel safety and compliance symbols	10
2	Getting Started 11	
	Check the Shipment and Order List 12	
	Power Requirements 13	
	Environmental Requirements 15	
	Safety Notice 18	
	Electrostatic Discharge Protection 19	
	Power on and Check 20	
	Some helpful Tips 22 Running Internal Alignments 22 Enable the Options 22 Using an External Reference 23 Firmware Revision 23	
	Remote Control 24	
3	Functions and Measurements 25	
	Making a Basic Measurement 26	
	Measuring Multiple Signals 30	

#### **Contents**

```
Measuring a Low-Level Signal
                                39
                                               44
Improving Frequency Resolution and Accuracy
Tracking Drifting Signals
                          46
Making Distortion Measurements
                                   48
Measuring Phase Noise
                          54
Stimulus Response Transmission
                                  55
Measuring Stop Band Attenuation of a Lowpass Filter
                                                      58
Making a Reflection Calibration Measurement
                                               61
Measuring Return Loss Using the Reflection Calibration
   Routine
              64
Viewing Catalogs and Saving Files
                                   65
Key Reference
                 71
Amplitude
             72
Auto Tune
             75
          76
Back <-
BW/Avg
           77
Det/Display
               81
Enter
        87
File/Print
            88
Frequency
             95
Marker
          97
Marker->
            101
Meas
         102
MODE
         103
Peak Search
               107
```

	Preset/System 111		
	SPAN 117		
	Sweep/Trig 118		
	View/Trace 120		
5	One-Button Measurements 121		
	Channel Power 122		
	Occupied BW 124		
	ACP 127		
	Intermod (TOI) 130		
	Spectrum Emission Mask 132		
6	Instrument Messages 139		
	Overview 140		
	Command Errors 141		
	Execution Conflict 143		
	Device-Specific Errors 145		
7	In Case of Difficulty 149		
	Check the Basics 150		
	Read the Warranty 151		
	Contact Agilent Technologies 152		
8	Menu Maps 153		
	Amplitude Menu 154		
	BW/Avg Menu 155		
	Det/Display Menu 156		
	File Menu (1 of 2) 157		

### **Contents**

File Menu (2 of 2) 158		
Frequency Menu 159		
Marker Menu 160		
Marker-> Menu 161		
Measure Menu (1 of 2) 162		
Measure Menu (2 of 2) 163		
MODE Menu 164		
Name editor Menu 165		
Peak Search Menu 166		
Preset/System Menu 167		
SPAN Menu 168		
Sweep/Trig Menu 169		
View/Trace Menu 170		
Index 171		

Agilent N9320A Spectrum Analyzer
User's Guide

1
Overview

Agilent N9320A at a Glance 2
Front Panel Overview 3
Rear Panel Overview 8
Front and rear panel safety and compliance symbols

This chapter provides a description of the Agilent N9320A spectrum analyzer and an introduction to the buttons, features, and functions of the front and rear instrument panels.

# Agilent N9320A at a Glance

The Agilent N9320A spectrum analyzer is a portable, swept spectrum analyzer with a frequency range of 9 kHz to 3.0 GHz. It can be a fundamental component of an automated system. It can also be widely used in an electronic manufacturing environment and in functional/final/QA test systems.

The Agilent N9320A spectrum analyzer primary features and functions are described below:

### · High sensitive measurement

The spectrum analyzer includes a pre-amplifier for signals in the frequency range up to 3 GHz, enabling more sensitive measurements. This feature is a great help in analysis of weaker signals.

#### Pass/fail limits

Upper and lower limits can be set on the screen, thereby enable the user to make fast, accurate, automated PASS/FAIL judgments on trace data.

### Four-trace detection display

The spectrum analyzer will display up to four independent traces simultaneously.

#### SSB Phase Noise Measurement

The analyzer provides automated, single-sideband phase noise measurement capability (dBc/Hz). The display includes frequency offset and the noise value data.


#### Frequency counter with 0.1 Hz resolution


A built-in frequency counter allows the user to measure the signal frequency with 0.1 Hz resolution.

#### USB interface

USB data interface ports allow the user to save and transfer a screen shot (in JPG format) to a USB storage device.

### Front Panel Overview

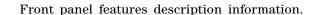

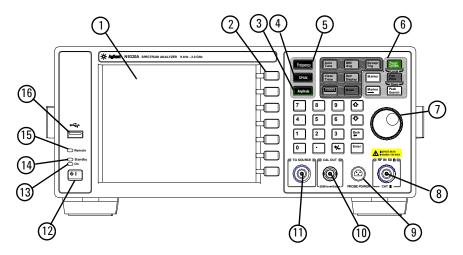

- 1 **Screen** displays current function information, which includes signal traces, status indicators, and instrument messages. Menu labels for the function softkeys are located on the right-hand side of the screen.
- **2 Softkeys** are the unlabeled keys to the right of the screen. The menu information for the active function is displayed to the immediate left of each softkey.
- **3 Amplitude** hardkey accesses the reference level function and amplitude softkey menu. Used to set functions that affect vertical axis data.
- **4 SPAN** hardkey to access the menu selection which set the frequency range symmetrically about the center frequency. The frequency-span readout displays the total displayed frequency range.
- **5 Frequency** hardkey accesses the center-frequency function, and the menu for frequency functions.

1

- **6 Function keys** hardkeys that are grouped in the upper right corner of the front panel. Their functions are defined below:
  - **Preset/System (Local)** hardkey accesses the softkeys to reset the analyzer to a known state, if the analyzer is in the remote mode, pressing this key returns the analyzer to the local mode and enables front-panel control.
  - **Auto Tune** hardkey searches the signal automatically and locates the signal to the center of the graticule. see "Auto Tune" on page 75.
  - **BW/Avg** hardkey activates the resolution bandwidth function and accesses the softkey menus that control the bandwidth functions and averaging.
  - **Sweep/Trig** hardkey accesses the softkey menus to set the sweep time, select the sweep and trigger mode.
  - **View/Trace** hardkey accesses the softkeys that allow you to store and manipulate trace information.
  - **Det/Display** hardkey accesses the softkey menus to configure detector functions and control the display settings on the analyzer. These include the display line value, and limit lines used in testing of trace data against the entered limit values.
  - **MODE** hardkey to select the measurement mode of the analyzer.
  - **Meas** hardkey accesses the softkey menu selections for transmitter power measurements such as adjacent channel power, occupied bandwidth, and harmonic distortion, etc. Refer to "One-Button Measurements" on page 121.
  - Marker hardkey accesses the marker control keys that select the type and number of markers and their on and off control.
  - Marker-> hardkey accesses the marker function softkeys that assist with measurements.
  - **Peak Search** hardkey places a marker on the highest peak.
  - File/Print hardkey accesses the softkey menus to configure the file type, save, and recall, and save location for the file.


- 7 Data Control Keys including the numeric keypad, arrow keys, back key, Enter key and knob. Used to change and control the numeric value of an active function such as center frequency, start frequency, resolution bandwidth, and marker position.
- **8 RF IN connector** is the signal input port for the analyzer. The limit for maximum damage level is an average continuous power of 40 dBm, DC voltage 50 VDC. The impedance is  $50 \Omega$  (N-type female).
- PROBE POWER connector provides DC power for high-impedance AC probes or other accessories (+15 VDC, -12 VDC, 150 mA maximum).
- **10 CAL OUT connector** provides an amplitude reference signal output of 50 MHz at -10 dBm (BNC female).
- 11 TG SOURCE connector (optional) N-type female, is the source output for the built-in tracking generator. The impedance is  $50~\Omega$  (for Option TG3)

### CAUTION

If the tracking generator output power is higher than the maximum power that the device under test can tolerate, it may damage the device under test. Do not exceed the maximum power of DUT.

- **Standby Switch** switches on all functions of the analyzer. To switch the analyzer off, press the switch for at least 2 seconds. This deactivates all the analyzer functions but allows power to be supplied to the internal circuits for as long as the analyzer is connected to AC line power.
- 13 On LED (green) lights when the analyzer is switched on.
- **Standby LED** (orange) lights when the analyzer is connected to the AC line power.
- **15 Remote LED** (red) lights when the analyzer is remotely controlled by a PC through the USB host interface connector on the rear panel.
- **16 USB connector (DEV)** provides a connection between the USB devices and the analyzer, such as a USB memory device.

# **Display Annotations**

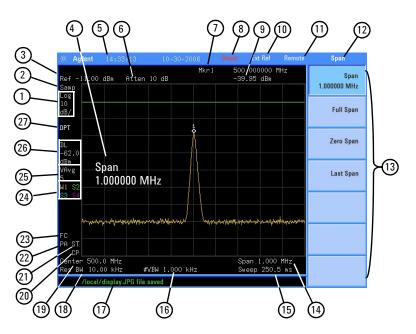


Item	Description	Notes (Associated function key)
1	Amplitude scale	[Amplitude] > Scale Type
2	Detector mode	[Det/Display] > Detector
3	Reference level	[Amplitude] > Rel Level
4	Active function block	The function currently in use
5	Time and date display	[Preset/System] > Time/Date
6	RF attenuation	[Amplitude] > Attenuation
7	Marker frequency	[Marker] or [Marker] > Function > Frequency Counter
8	Uncal indicator	The readout of amplitude is uncalibrated.
9	Marker amplitude	[Marker]
10	External reference	An external frequency reference is in use.
11	Remote mode	The analyzer is in remote mode
12	Key menu title	Dependent on current function key selection.

13	Softkey menu	Refer to "Key Reference" for details.  Dependent on current function key selection.
14	Frequency span	[SPAN]
15	Sweep time	[Sweep/Trig] > Sweep Time
16	Video bandwidth	[BW/Avg] > Video BW
17	Display status line	Display status and instrument messages.
18	Resolution bandwidth	[BW/Avg] > Res BW
19	Center frequency	[Frequency] > Center frequency
20	Continuous peak	[Peak Search] > Continuous Pk
21	Signal track	[Frequency] > Signal Track
22	Internal preamplifier	[Amplitude] > Int Preamp
23	Trigger/Sweep F - free run trigger V - video trigger E - external trigger C - continuous sweep S - single sweep	[Sweep/Trig] example: FC = free run trigger, continuous sweep mode
24	Trace mode W - clear write M - maximum hold m - minimum hold V - view S - store blank	[Trace] examples: W1 = trace 1, clear write mode M2 = trace 2, max hold mode S3 = trace 3, store blank mode (not active) traces are color coded for differentiation.
25	Average VAvg - video average PAvg - power average	[BW/Avg] > Average On Off
26	Display line	[Det/Display] > display Line On Off
27	Optimized Phase <sup>a</sup>	[Marker] > Function > Optimize Phase Noise

a. Optimized Phase is only available when SPAN doesn't exceed 50 kHz.

# **Rear Panel Overview**

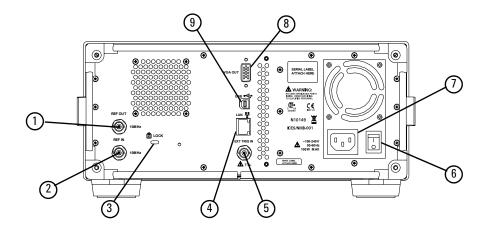

- 1 **REF OUT connector** provides a frequency of 10 MHz, amplitude of -10 dBm reference output. (BNC female)
- **2 REF IN connector** accepts an external timebase with a frequency of 10 MHz, amplitude of -5 to +10 dBm (BNC female).
- **3 Kensington Lock** lock the instrument for safety.
- **4 LAN port** is reserved for future expansion.
- **5 EXT TRG IN (TTL) connector** accepts an external voltage input, the positive edge of which triggers the analyzer sweep function (BNC female).
- **6 Power switch** isolates the analyzer from the AC line power. After switch on, the analyzer enters into standby mode and the orange standby LED on the front panel lights.
- **7 AC power receptacle** accepts a three-pin line power plug.
- **8 VGA connector** provides the video output signal to an external monitor or projector (D-sub 15-pin female).
- **9 USB Host connector** provides a connection between the analyzer and an PC for remote control.

# Front and rear panel safety and compliance symbols



**The instruction manual symbol**: indicates that the user must refer to specific instructions in the manual.



The CE mark: a registered trademark of the European Community.

ISM1-A

Shows that this is an Industrial Scientific and Medical Group 1 Class A product. (CISPR 11, Clause 4)



**The CSA mark:** a registered trademark of the Canadian Standards Association International.

ICES/NMB-001

The ISM device complies with Canadian Interference-Causing Equipment Standard-001.

Cet appareil ISM est conforme à la norme NMB-001 du Canada.



**The C-Tick mark**: a trademark registered to the Australian Communication Media Authority. It indicates compliance with all Australian EMC regulatory information.



marks the "on/standby" position of the switch.




indicates that the instrument requires AC power input.



indicates this product complies with the **WEEE Directive**(2002/96/EC) marking requirements and you must not discard this equipment in domestic household waste. Do not dispose in domestic household waste. To return unwanted products, contact your local Agilent office, or refer to <a href="http://www.agilent.com/environment/product/">http://www.agilent.com/environment/product/</a>

### 1 Overview

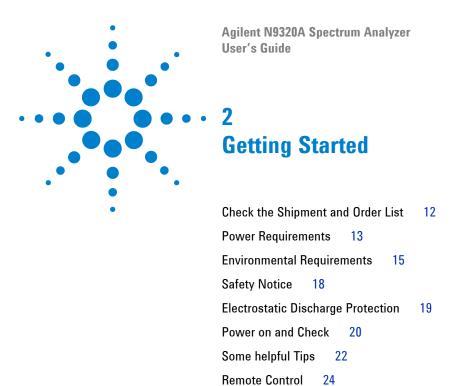

This chapter gives you the information to start using the spectrum analyzer correctly.

# **Check the Shipment and Order List**

After receiving the shipment, first check the shipment and your order list according to the following procedure.

- Inspect the shipping container for damage.
   Signs of damage may include a dented or torn shipping container or cushioning material that indicate signs of unusual stress or compacting.
- Carefully remove the contents from the shipping container and verify that your order is complete. Each spectrum analyzer includes the following items as standard:

Item	Quantity	Part number
N9320A Spectrum Analyzer	1	N9320A
USB cable	1	8121-1515
N-BNC adapter	1	1250-0780
BNC cable	1	8120-2682
Three-pin power cord	1	Specific to shipping location
Help kit CD-ROM	1	N9320-84500
Calibration certificate	1	5962-0476

• Verify if that the shipment includes your ordered options by checking the option label on the rear panel:

Option	Name	Part number
PA3	3 GHz Preamplifier	N9320A-PA3
TG3 3 GHz Tracking Generator		N9320A-TG3
1HB	Handle and bumpers	N9320A-1HB
1CM	Rackmount kit	N9320A-1CM
1TC	Hard transit case	N9320A-1TC

For any questions about your shipment, Contact Agilent Technologies for consulting and service.

# **Power Requirements**

The spectrum analyzer has an auto-ranging line voltage input. The AC power supply must meet the following requirements:

**Voltage:** 100 to 240 VAC (90 to 264 VAC)

Frequency: 50 to 60 Hz

Power: Maximum 100 W

### **AC Power Cord**

The analyzer is equipped with a three-wire power cord, in accordance with international safety standards. This cable grounds the analyzer cabinet when connected to an appropriate power line outlet. The cable appropriate to the original shipping location is included with the analyzer.

Various AC power cables are available that are unique to specific geographic areas. You can order additional AC power cables for use in different areas. The table **AC Power Cords** lists the available AC power cables, the plug configurations, and identifies the geographic area in which each cable is appropriate.

The detachable power cord is the product disconnecting device. It disconnects the mains circuits from the mains supply before other parts of the product. The front panel switch is only a standby switch and do not disconnect instrument from LINE power.

### **AC Power Cords**

Plug Type	Cable Part Number	Plug <sup>a</sup> Description	For use in Country & Region
250V 10A	8121-1703	BS 1363/A	Option 900 United Kingdom, Hong Kong, Singapore, Malaysia
250V 10A	8120-0696	AS 3112:2000	Option 901 Australia, New Zealand
250V 16A	8120-1692	IEC 83 C4	Option 902 Continental Europe, Korea, Indonesia, Italy, Russia
125V 10A	8120-1521	CNS 10917-2 /NEMA 5-15P	Option 903 Unite States, Canada, Taiwan, Mexico
250V 10A	8120-2296	SEV 1011	Option 906 Switzerland
230V 15A	8120-4600	SABS 164-1	Option 917 South Africa, India
125V 15A	8120-4754	JIS C8303	Option 918 Japan
250V 16A	8120-5181	SI 32	Option 919 Israel
250V 10A	8120-8377	GB 1002	Option 922 China

a. Plug description describes the plug only. The part number is for the complete cable assembly.

# **Environmental Requirements**

Agilent Technologies has designed this product for use in Installation Category II, Pollution Degree 2, per IEC 61010-1. Agilent has designed the spectrum analyzer for use under the following conditions:

- Indoor use
- Altitude < 3,000 meters
- Operating temperature range: +5 to +45 °C;
   Storage temperature range: -20 to +70 °C
- Relative humidity range 15% to 95 %

### **Ventilation**

Ventilation holes are located on the rear panel and one side of the spectrum analyzer cover. Do not allow these holes to be obstructed, as they allow air flow through the spectrum analyzer.

When installing the spectrum analyzer in a cabinet, do not restrict the convection of the analyzer. The ambient temperature outside the cabinet must be less than the maximum operating temperature of the spectrum analyzer by  $4~^{\rm o}{\rm C}$  for every 100 watts dissipated within the cabinet.

# **Cleaning Tips**

To prevent electrical shock, disconnect the spectrum analyzer from line power before cleaning. Use a dry cloth or one slightly dampened with water to clean the external case parts. Do not attempt to clean internally.


### **Rack Mount**

It is recommended to use the Agilent rackmount kit (option 1CM) to install the spectrum analyzer into a rack.


Do not attempt to rack mount the spectrum analyzer by the front panel handles only. This rackmount kit will allow mounting of the spectrum analyzer with or without handles.

Refer to the following instructions when installing the rackmount kit on the spectrum analyzer.

- 1 Remove feet, key-locks and tilt stands.
- 2 Remove side trim strips and a middle screw per side.

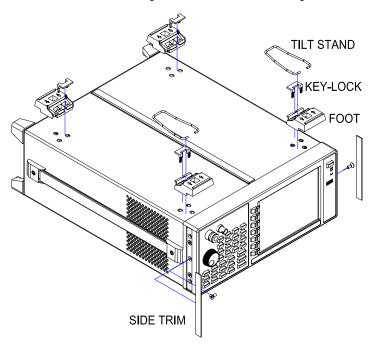

**3** Attach rackmount flange and front handle assembly with 3 screws per side.

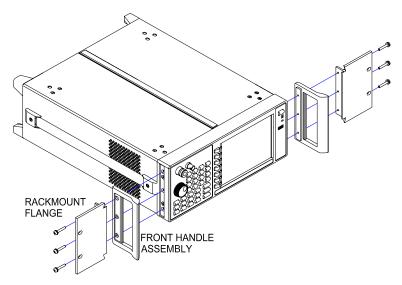

4 Attach the spectrum analyzer to the rack using the rackmount flanges with two dress screws per side.

# CAUTION

Installing the spectrum analyzers into other racks may promote shock hazards, overheating, dust contamination, and inferior system performance. Consult your Agilent customer engineer about installation, warranty, and support details.

# **Transit**

It is recommended to use the hard transit case (option 1TC) for instrument transportation.

# **Safety Notice**

Read the following warnings and cautions carefully before powering on the spectrum analyzer to ensure personal and instrument safety.

### WARNING

Always use a well-grounded, three-pin AC power cord to connect to power source. Personal injury may occur if there is any interruption of the AC power cord. Intentional interruption is prohibited. If this product is to be energized via an external auto transformer for voltage reduction, make sure that its common terminal is connected to a neutral (earthed pole) of the power supply.

### WARNING

Personal injury may result if the spectrum analyzer covers are removed. There are no operator serviceable parts inside. To avoid electrical shock, refer servicing to qualified personnel.

### WARNING

Electrical shock may result if the spectrum analyzer is connected from the power supply while cleaning. Do not attempt to clean internally.

### CAUTION

Prevent damage to the instrument and ensure protection of the input mixer by limiting average continuous power input to +30 dBm, DC voltage to 50 VDC, maximum pulse voltage to 125 V. Instrument damage may result if these precautions are not followed.

# **Electrostatic Discharge Protection**

Electrostatic discharge (ESD) damages or destroys electronic components (the possibility of unseen damage caused by ESD is present whenever transported, stored, or while the instrument is in use).


This product contains components that are easily damaged by electrostatic discharge. To help reduce the possibility of ESD damage that can occur while using test equipment, follow these guidelines:

- 1 Before connecting any coaxial cable to the spectrum analyzer connector for the first time each day, momentarily short the center and outer conductors of the cable together to eliminate any potential electrostatic charges that may exist.
- 2 Personnel should be grounded with an approved type, 1 M $\Omega$  resistor-isolated ESD wrist-strap before touching the center pin of any connector, and before removing any assembly from the spectrum analyzer.
- **3** Be sure that all instruments are properly earth grounded to prevent build-up of static charges.

For more information about ESD and how to prevent ESD damage, contact the Electrostatic Discharge Association (http://www.esda.org). The ESD standards developed by this agency are sanctioned by the American National Standards Institute (ANSI).

## **Power on and Check**

1 Connect the AC power cord into the instrument. Insert the plug into a power socket provided with a protective earth. Set the tilt adjustors for your preference.

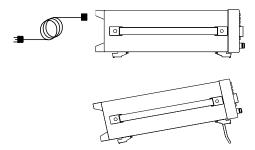

- 2 Press the AC line switch on the rear panel. The standby LED (orange) on the front panel will light and the spectrum analyzer is in standby mode (AC power applied).
- 3 Press the standby switch b on the front panel. The On LED (green) will light, and the spectrum analyzer boots up.

Self-initialization takes about 25 seconds; the spectrum analyzer then defaults to the menu mode. After power on, let the spectrum analyzer warm up for 45 minutes for stabilization.

NOTE

The front panel switch is a standby switch only; it is not a power switch. To completely disconnect the spectrum analyzer from the AC line power, shut off the power switch on the rear panel.

# **Check for Instrument Messages**

The spectrum analyzer has two categories of instrument messages: error and warning messages. A error message is triggered by operation errors, for example, parameter setting conflicts or data input that is out of the range of a parameter. An warning message may be triggered by hardware defects which could result in damage to instrument.

Here are some tips to check the instrument messages.

- 1 Check the display to see if any messages display in the status bar. Press | Nore > Show Errors to review each messages. Refer to Chapter 6, "Instrument Messages" for detailed system messages descriptions.
- When you have reviewed and resolved all of the error messages, press System > More > Show Errors > Clear error queue to delete the messages.
- **3** Cycle the power to the analyzer and re-check to see if the Instrument messages is still there.
- **4** If the error messages cannot be resolved, contact the Agilent Customer Contact Center for assistance or service.

# Some helpful Tips

The following contains information to help in using and maintaining the instrument for optimum operation, including alignment, external reference, firmware update and option activation.

# **Running Internal Alignments**

To meet the instrument performance specifications, the analyzer must periodically be manually aligned.

NOTE

When an alignment is being run, there will be an audible clicking sound as the attenuator settings are changed. This sound is not an indication of a problem.

- 1 Connect a BNC cable with a correct type N-BNC adapter between the **CAL OUT** and **RF IN** front panel connectors.
- 2 After instrument warm-up, press Preset > Alignment > Align > All

Refer to "Alignment" on page 112 for details.

## **Enable the Options**

Option license key information is required to enable product options. Contact your nearest Agilent Office for purchasing a license. Refer to the procedures below to activate the options you have purchased. (option TG3 and option PA3)

- 1 Press Preset > More > More > Licensing > Option
- **2** Enter the option number to be enabled. Press **[Enter]** to confirm your input.
- 3 Press Preset > More > More > Licensing > License key
- 4 Enter the license key information. Press [Enter] to confirm your input and terminate the license key input. The option will be enabled immediately.

# **Using an External Reference**

To use an external 10 MHz source as the reference frequency, connect the external reference source to the **REF** IN connector on the rear panel. An EXT REF indicator will display in the upper bar of the display. The signal level must be in the range of -5 to +10 dBm.

### **Firmware Revision**

Press Presst > More > Show software to view the firmware revision of your analyzer. If you call Agilent Technologies regarding your analyzer, it is helpful to have this revision and the analyzer serial number available. To update the firmware, refer to:

http://www.agilent.com/find/n9320a

Follow this procedure to finish the firmware update:


- 1 Download the firmware package from web. Extract and copy the file *version* and folder "n9320a" into the root directory of a USB stick.
- **2** Turn the N9320A off. Then insert the USB stick into the USB connector.
- **3** Power on your spectrum analyzer, the instrument will perform the update process automatically. The upgrade procedure will take about 10 minutes.

CAUTION

Any interruption during the update process will result in update failure and system data lost. Do not remove the USB storage device until the update is finished.

# **Remote Control**

The N9320A spectrum analyzer is capable of being connected to a PC through a USB connection, allowing the analyzer to be operated in remote mode.

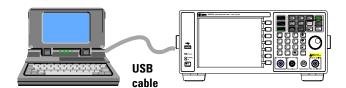

The configuration for setting up a remote control for your N9320A is easily done: connect your N9320A using a USB cable to a PC which has had Agilent IO Libraries Suite installed.



When connecting a PC to the spectrum analyzer, power on the spectrum analyzer. The PC will then detect if there is a connection to the spectrum analyzer.

To maximize the flexibility of the remote control feature, use SCPI commands to create your own programs.

For more information about Agilent IO Libraries Suite, refer to: http://www.agilent.com/find/iolib

For further information on remote control and programming, refer to the N9320A Programmer's Guide in the N9320A Help Kit CD.



Agilent N9320A Spectrum Analyzer User's Guide

# **Functions and Measurements**

Making a Basic Measurement 26		
Measuring Multiple Signals 30		
Measuring a Low-Level Signal 39		
Improving Frequency Resolution and Accuracy 43		
Tracking Drifting Signals 45		
Making Distortion Measurements 47		
Measuring Phase Noise 53		
Stimulus Response Transmission 54		
Measuring Stop Band Attenuation of a Lowpass Filter 57		
Making a Reflection Calibration Measurement 60		
Measuring Return Loss Using the Reflection Calibration Routine 63		
Viewing Catalogs and Saving Files 64		

This chapter provides information on the analyzer functions and specific measurements capabilities of the spectrum analyzer.

It is assumed that the operator has an understanding of the front and rear panel layout, and display annotations of the analyzer. For information on the front panel and display details, refer to "Agilent N9320A at a Glance" on page 2.

# Making a Basic Measurement

In this guide, the keys labeled with [ ], for example, [Preset/System] refer to front-panel hardkeys. Pressing many of the hardkeys accesses softkey menus that are displayed along the right side of the screen. The softkey menu labels are aligned so that they are located next to the softkeys at the right side of the display screen. For example, Preset is a softkey menu selection when first pressing [Preset/System].

# **Using the Front Panel**

This section provides you with the information on using the front panel of the spectrum analyzer.

### **Entering Data**

When setting the measurement parameters, there are several ways to enter or modify the value of the active function:

**Knob** Increments or decrements the current value.

Arrow Keys Increments or decrements the current value by a step unit.

(either a unit softkey, or [Enter] hardkey).

**Unit Softkeys** Terminate (enter) a value with a unit softkey from the menu.

Enter Key Terminates an entry when no unit of measure is required, or

the instrument uses the default unit.

**Back Key** To delete the current input digit prior to entering the value.

### **Using Softkeys**

Softkeys are used to modify the analyzer function parameter settings. Some examples of softkey types are:

**Toggle** Turn on or off an instrument state.

**Submenu** Displays a secondary menu of softkeys, {More}.

**Choice** Selecting from a list of standard values or filenames.

Adjust Highlights the softkey and sets the active function.

# **Presetting the Spectrum Analyzer**

Preset function provides a known instrument status for making measurements. There are two types of presets, factory and user:

#### **Factory Preset**

When this preset type is selected, it restores the analyzer to its factory-defined state. A set of known instrument parameter settings defined by the factory. Refer to "Factory Preset State" on page 111 for details.

#### **User Preset**

Restores the analyzer to a user-defined state. A set of user defined instrument parameter settings saved for assisting the user in quickly returning to known a instrument measurement setup.

Press Preset > Pwr on/Preset > Preset Type to select the preset type.

When **Preset Type** is set to **Factory**, pressing Preset triggers a factory preset condition. The instrument will immediately return to the factory default instrument parameter setting.

When **Preset Type** is set to **User**, pressing Preset System > **Preset** displays both **User Preset** and **Factory Preset** softkeys. The user may then select the preset desired from the softkey menu selections.

### **Setting up a User Preset**

To quickly return to instrument settings that are user defined, perform the following steps to save the instrument state as the user-defined preset:

- 1 Set the instrument parameters to the values and settings necessary for the user preset state. This would include the frequency, span, amplitude, BW, and measurement type and any other setup details desired.
- Press Preset > Pwr on/Preset > Save User Preset, to save the current instrument settings as the 'user preset' state. The user preset will not affect the default factory preset settings. User preset settings can be changed and saved at any time.

3

# Viewing a Signal

Refer to the procedures below to view a signal.

- 1 Press Preset > Pow on/Preset > Preset Type > Factory to enable the factory-defined preset state.
- 2 Press Preset > Preset to restore the analyzer to its factory-defined state.
- **3** Connect the 10 MHz **REF OUT** on the rear panel to the front-panel **RF IN**.

### **Setting the Reference Level and Center Frequency**

- 1 Press Amplitude > 10 > dBm to set 10 dBm reference level.
- 2 Press Frequency > 30 > MHz to set 30 MHz to center frequency.

### **Setting Frequency Span**

Press SPAN > 50 > MHz to set 50 MHz frequency span.

NOTE


Changing the reference level changes the amplitude value of the top graticule line. Changing the center frequency changes the horizontal placement of the signal on the display. Increasing the span will increase the frequency range that appears horizontally across the display.

### **Reading Frequency and Amplitude**

Press Rearch to place a marker (labeled 1) on the 10 MHz peak.

Note that the frequency and amplitude of the marker appear both in the active function block, and in the upper-right corner of the screen.

Figure 1 10 MHz Internal Reference Signal

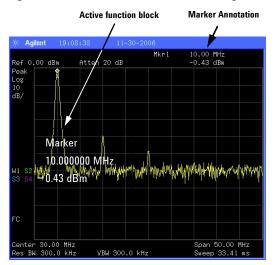

2 Use the knob, the arrow keys, or the softkeys in the **Peak Search** menu to move the marker. The marker information will be displayed in the upper-right corner of the screen.

### **Changing Reference Level**

- 1 Press Amplitude and note that reference level (Ref Level) is now the active function.
- 2 Press Marker > Mkr-> Ref Lvl.

NOTE

Changing the reference level changes the amplitude value of the top graticule line.

# **Measuring Multiple Signals**

This section provides the information on how to measure multiple signals.

# Comparing Signals on the Same Screen Using Marker Delta

The delta marker function allows the user to compare two signals when both appear on the screen at the same time.

In the following example, harmonics of the 10 MHz reference signal available are used to measure frequency and amplitude differences between two signals on the same screen. Delta marker is used to demonstrate this comparison.

- 1 Preset the analyzer:
  - Press | Preset | Preset (With Preset Type of Factory)
- 2 Connect the rear panel **REF OUT** to the front panel **RF IN**.
- 3 Set the analyzer center frequency, span and reference level to view the 10 MHz signal and its harmonics up to 50 MHz:

Press Frequency > 30 > MHz

Press SPAN > 50 > MHz

Press Amplitude > 10 > dBm

4 Place a marker at the highest peak on the display (10 MHz):

Press Peak Search

The marker should be on the 10 MHz reference signal. Use the **Next Pk Right** and **Next Pk Left** softkeys to move the marker from peak to peak.

**5** Anchor the first marker and activate a second marker:

Press Marker > Delta > Delta (On)

The label on the first marker now reads 1R, indicating that it is marking the reference point.


6 Move the second marker to another signal peak using the front-panel knob or by using **Peak Search**.

 $Press \begin{array}{|c|c|}\hline Peak \\ Search \\ \hline \end{array} > \textbf{Next Peak} \ \, \text{or}$ 

Press Peak > Next Pk Right or Next Pk Left. Continue pressing the Next Pk softkeys until the marker is on the correct signal peak.

The amplitude and frequency differences between the markers are displayed in the active function block.

Figure 2 Delta pair marker with signals on the same screen

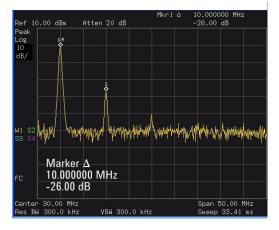

NOTE

To increase the resolution of the marker readings, turn on the frequency count function. For more information, refer to "Improving Frequency Resolution and Accuracy" on page 45.

# Comparing Signals not on the Same Screen Using Marker Delta

The analyzer will compare the frequency and amplitude differences between two signals which are not displayed on the screen at the same time. (This technique is useful for harmonic distortion tests.)

In this example, the analyzer's 10 MHz signal is used to measure frequency and amplitude differences between a signal on screen, and another signal off screen. Delta marker is used to demonstrate this comparison.

- **1** Preset the analyzer:
  - Press Preset (With Preset Type set to Factory)
- 2 Connect the rear panel **REF OUT** to the front panel **RF IN**.
- 3 Set the center frequency, span and reference level to view only the 50 MHz signal:

Press Frequency > Center Freq > 50 > MHz

Press Span > Span > 25 > MHz

Press Amplitude > Ref Level > 10 > dBm

4 Place a marker on the 50 MHz peak and then set the center frequency step size equal to the marker frequency (10 MHz):

Press Peak Search

Press Marker > Mkr -> CF Step

**5** Activate the marker delta function:

Press Marker > Delta > Delta (On)

**6** Increase the center frequency by 10 MHz:

Press Frequency > Center Freq, ♠

The first marker moves to the left edge of the screen, at the amplitude of the first signal peak.

Figure 3 shows the reference annotation for the delta marker (1R) at the left side of the display, indicating that the marker set at the 50 MHz reference signal is at a lower frequency than the frequency range currently displayed.

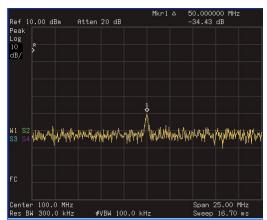


Figure 3 Delta Marker with Reference Signal Off-Screen


The delta marker appears on the peak of the 100 MHz component. The delta marker annotation displays the amplitude and frequency difference between the 50 and 100 MHz signal peaks.

7 Press Marker > Off to turn the markers off.

### **Resolving Signals of Equal Amplitude**

In this example a decrease in the resolution bandwidth (RBW) is used in combination with a decrease in video bandwidth (VBW) to resolve two signals of equal amplitude with a frequency separation of 100 kHz.

Figure 4 Setup for obtaining two signals

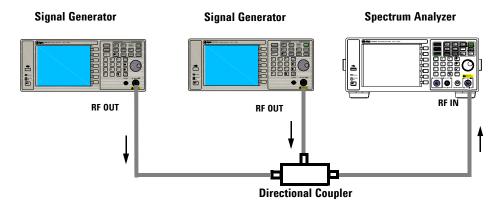

Notice that the final RBW selection to resolve the signals is the same width as the signal separation while the VBW is slightly narrower than the RBW.

- 1 Connect two sources to the analyzer input as shown above.
- 2 Set one source to 300 MHz. Set the frequency of the other source to 300.1 MHz. Set both source amplitudes to -20 dBm.
- **3** Setup the analyzer to view the signals:

Press Preset (With Preset Type of Factory)
Press Frequency > 300 > MHz
Press RW/ > 300 > kHz
Press PAN > 2 > MHz

A single signal peak is visible. See Figure 5 for example.

If the signal peak is not present on the display, increase the frequency span out to 20 MHz, turn signal tracking on, decrease the span back to 2 MHz and turn signal tracking off:

Press Span > Span > 20 > MHz


Press Peak Search

Press Frequency > Signal Track (On)

Press SPAN > 2 > MHz

Press Frequency > Signal Track (Off)

Figure 5 Unresolved Signals of Equal Amplitude

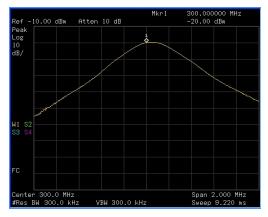

4 Change the resolution bandwidth (RBW) to 100 kHz so that the RBW setting is less than or equal to the frequency separation of the two signals:

Press | No > kHz

Notice that the peak of the signal has become flattened indicating that two signals are present.

**5** Decrease the video bandwidth to 3 kHz:

Press | W > Video BW > 3 > kHz

#### 3 Functions and Measurements

Two signals are now visible as shown in Figure 6. Use the front-panel knob or arrow keys to further reduce the resolution bandwidth and better resolve the signals.

Decreasing the resolution bandwidth improves the resolution of the individual signals and increases the sweep time.

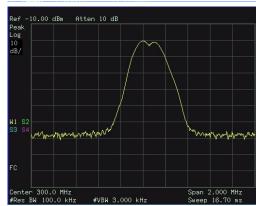


Figure 6 Resolving Signals of Equal Amplitude

For fastest measurement times, use the widest possible resolution bandwidth. Under factory preset conditions, the resolution bandwidth is coupled to the span.

# **Resolving Small Signals Hidden by Large Signals**

This example uses narrow resolution bandwidths to resolve two RF signals that have a frequency separation of 50 kHz and an amplitude difference of 60 dB.

- 1 Connect two sources to the **RFIN** as shown in Figure 4.
- 2 Set one source to 300 MHz at -10 dBm. Set the other source to 300.05 MHz at -70 dBm.
- **3** Set the analyzer as follows:

Press Preset | Preset Type of Factory)

Press Frequency > 300 > MHz

Press  $\frac{BW}{AVR} > 30 > kHz$ 

Press SPAN > 500 > kHz

**4** Set the 300 MHz signal to the reference level:

Press Peak Search

Press Marker > Mkr -> Ref Lel


NOTE

The 30 kHz filter shape factor of 15:1 has a bandwidth of 450 kHz at the 60 dB point. The half-bandwidth (225 kHz) is NOT narrower than the frequency separation of 50 kHz, so the input signals can not be resolved.

Figure 7 Unresolved small signal from large signal

Ref -16.52 dBm Atten 10 dB -16.53 dBm

Peak 9

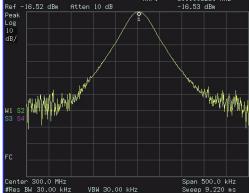

#### 3 **Functions and Measurements**

5 Reduce the resolution bandwidth filter to view the smaller signal. The smaller signal will be hidden by the larger signal when the bandwidth settings are wider, as in Figure 7. Reducing the RBW setting will allow less of the larger signal to pass through the analyzer and the smaller signals peak will then rise out of the noise floor. Place a delta marker on the smaller signal:

> 1 > kHz Press Press Press Marker > Delta > Delta (On) Press 50 > kHz

Figure 8 Resolved small signal from large signal



NOTE

The 1 kHz filter shape factor of 15:1 has a bandwidth of 15 kHz at the 60 dB point. The half-bandwidth (7.5 kHz) is narrower than the frequency separation of 50 kHz, so the input signals can be resolved.

# Measuring a Low-Level Signal

This section provides information on measuring low-level signals and distinguishing them from spectrum noise.

# **Reducing Input Attenuation**


The ability to measure a low-level signal is limited by internally generated noise of the spectrum analyzer. The analyzers input attenuator affects the level of a signal passing through the analyzer. If a signal power level is close to the noise floor, reducing the analyzer input attenuation will help raise the signal so that it can be seen rising out of the noise.

### CAUTION

Ensure that the total power of all input signals at the analyzer RF input does not exceed +30 dBm (1 Watt).

- 1 Preset the analyzer
  - Press | Preset | > Preset (With Preset Type of Factory)
- 2 Set the source frequency to 300 MHz, amplitude to -70 dBm. Connect the source **RF OUT** to the analyzer **RF IN**.

Figure 9 Setup for obtaining one signal

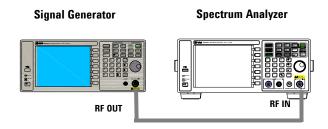

#### 3 Functions and Measurements

3 Set the center frequency, span and reference level:

Press Frequency > Center Freq > 300 > MHz

Press Span > 2 > MHz

Press Amplitude > Ref Level > 40 > -dBm.

**4** Move the desired peak to the center of the display:

Press Peak

Press Marker > Mkr -> CF


**5** Reduce the span to 500 kHz, if necessary re-center the peak:

Press > 500 > kHz

**6** Set the attenuation to 20 dB:

Press Amplitude > Attenuation > 20 > dB

Figure 10 A signal closer to the noise level

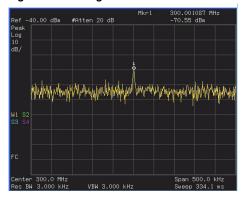


Note that increasing the attenuation moves the noise floor closer to the signal level.

7 To allow more of the signal power to pass through the analyzer, decrease the attenuation to 0 dB.

A lower attenuation value will mean that more of the signal strength will be displayed on screen:

Press Amplitude > Attenuation > 0 > dB

Figure 11 Measuring a low-level signal using 0 dB Attenuation

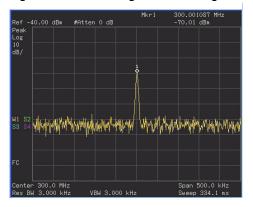

### **Decreasing the Resolution Bandwidth**

Resolution bandwidth settings affect the level of internal noise but have little affect on the displayed level of continuous wave (CW) signals. Decreasing the RBW by a decade (factor of ten) reduces the noise floor by 10 dB.

- 1 Refer to the procedure "Reducing Input Attenuation" on page 39 and follow steps 1, 2 and 3.
- **2** Decrease the resolution bandwidth:

Press BW/ and 🗣

The low-level signal appears more clearly due to the noise level being reduced by the decrease in RBW (see Figure 12).

Figure 12 Decreasing Resolution Bandwidth

A "#" mark appears next to the Res BW annotation in the lower left corner of the screen, indicating that the resolution bandwidth is uncoupled.

Uncoupled indicates that the function is in manual control mode, not auto control mode. Manual control mode allows the user to change the parameter value for that function without affecting any other settings.

NOTE

The analyzer allows you to change the RBW in a 1-3-10 sequence by the data control keys. The RBWs below 1 kHz are digital and have a selectivity ratio of 5:1 while RBWs at 1 kHz and higher have a 15:1 selectivity ratio. The maximum RBW is 3 MHz and minimum is 10 Hz.

### **Trace Averaging**

Averaging is a digital process in which each sweep of the trace returns measurement values for each point in the trace. These values are then mathematically averaged with the previous sweep trace data which has been stored in the analyzer. The amount of averaging is selected by choosing the number of trace sweeps to be included in the process. The averaging function uses the most recent trace sweep values so that the display shows any signal changes.

Selecting averaging, when the analyzer is auto-coupled, changes the detection mode to **Sample**, smoothing the displayed noise level.

### NOTE

This is a trace processing function and is not the same as using the average detector (as described on page 42).

- 1 Refer to the procedure "Reducing Input Attenuation" on page 39 of this chapter and follow steps 1, 2 and 3.
- 2 To turn averaging on, toggle the softkey menu labeled **Average**:


Press | No Series | No Series

3 Set the number of averages to 20, using the number keypad, up and down arrows, or the knob:

Press 20, Enter

The averaging process smooths the viewed trace, low level signals become more visible (see Figure 13). Changes to the average number will restart the averaging process.

Figure 13 Trace Averaging

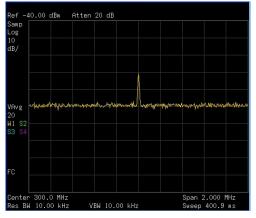

#### 3


# **Improving Frequency Resolution and Accuracy**

This section provides information on using the frequency counter function to improve frequency resolution and accuracy.

- 1 Press Preset (With Preset Type of Factory)
- 3 Press Auto hardkey.

The analyzer will detect the signal peak and locate it to the center of the display screen (Refer to "Auto Tune" on page 75).

- **4** Turn the frequency counter on:
  - Press Marker > Function > Freq Counter > Freq Counter (On).
- Move the marker, with the front-panel knob, half-way down the skirt of the signal response.

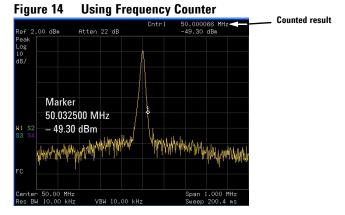

NOTE

The frequency and amplitude of the marker appears in the active function area (this is not the counted result). The counted result appears in the upper-right corner of the display to the right-side of Cntr1.

The marker readout in the active frequency function changes while the counted frequency result (upper-right corner of display) does not. For an accurate count, the marker need not be placed at the exact peak of the signal response.

### NOTE

The Frequency counter properly functions only on stable, CW signals or discrete spectral components. The marker power level must be greater than 40 dB above the displayed noise level.

**6** To change the counter resolution:

Press Marker > Function > Freq Counter > Resolution

The frequency-counter resolution range is from 1 Hz to 1 kHz, and may be set to Auto or Manual.

7 To turn off the marker counter:

Press Marker > Function > Freq Counter > Freq Counter (Off).

#### NOTE

When using the frequency counter function, the ratio of the resolution bandwidth to the span must be greater than 0.02.

# **Tracking Drifting Signals**

This section provides information on measuring and tracking signals that drift in frequency.

# Measuring a Source's Frequency Drift

The analyzer will measure source stability. The maximum amplitude level and the frequency drift of an input signal trace can be displayed and held by using the maximum hold function. Using the maximum hold function you can measure and determine how much of the frequency spectrum a signal occupies. For more information, refer to "Max Hold" on page 119.

Use signal tracking to return a signal drifting in frequency to the center of the display. The drifting is captured by the analyzer using the maximum hold function.

- 1 Connect the signal generator to the analyzer RF IN.
- 2 Output a signal with the frequency of 300 MHz and amplitude of -20 dBm.
- 3 Set the analyzer center frequency, span and reference level.

Press | Preset | > Preset. (With Preset Type of Factory)

Press Frequency > Center Freq > 300 > MHz

Press SPAN > Span > 10 > MHz

Press Amplitude > Ref Level > -10 > dBm

4 Place a marker on the peak of the signal and turn signal tracking on:

Press Peak Search

Press Frequency > Signal Track (On)

Press SPAN > 1 > MHz

Notice that this holds the signal in the center of the display.

**5** Turn off the signal track function:

Press Frequency > Signal Track (Off)

**6** Measure the excursion of the signal with maximum hold:

Press View > Max Hold

As the signal varies, maximum hold maintains the maximum responses of the input signal. Annotation on the left side of the screen indicates the trace mode. For example, M1 S2 S3 S4, indicates trace 1 is in maximum-hold mode, trace 2, trace 3, and trace 4 are in store-blank mode.


**7** Activate trace 2 and change the mode to continuous sweep:

**Press Clear Write** 

Trace 1 remains in maximum hold mode to show any drift in the signal.

8 Slowly increase the frequency of the signal generator. Your analyzer display should look similar to Figure 15.

Figure 15 Viewing a Drifting Signal With Max Hold and Clear Write

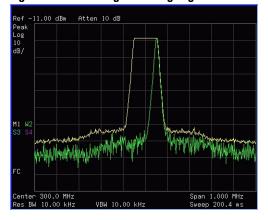

# **Making Distortion Measurements**

This section provides information on measuring and identifying signal distortion.

### **Identifying Analyzer Generated Distortion**


High-level input signals may cause analyzer distortion products that could mask the real distortion measured on the input signal. Use trace and the RF input attenuator to determine which signals, if any, are internally generated distortion products.

In this example, we use the RF output of a signal generator to determine whether the harmonic distortion products are internally generated by the analyzer.

- 1 Connect the signal generator to the analyzer RF IN.
- 2 Set the source frequency to 200 MHz, amplitude to 0 dBm.
- 3 Set the analyzer center frequency and span:

Press Frequency > 400 > MHz
Press SPAN > 500 > MHz

Figure 16 Harmonic Distortion

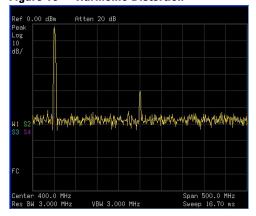

The signal produces harmonic products (spaced 200 MHz from the original 200 MHz signal) in the analyzer input mixer as shown in Figure 16.

**4** Change the center frequency to the value of the first harmonic:

Press Peak Search > Next Peak

Press Marker > Mkr -> CF

**5** Change the span to 50 MHz and re-center the signal:

Press SPAN > 50 > MHz

Press Peak Search

Press Marker > Mkr -> CF

**6** Set the attenuation to 0 dB:

Press Amplitude > Attenuation > 0 > dB

7 To determine whether the analyzer generates harmonic distortion products, first display the trace data in trace 2 as follows:

Press View > Select Trace > Trace 2

**Press Clear Write** 

Allow trace 2 to update (minimum two sweeps), then store the data from trace 2 and place a delta marker on the harmonic of trace 2:

Press View > View

Press Peak Search

Press Marker > Delta > Delta (On)


The analyzer display shows the stored data in trace 2 and the measured data in trace 1. The  $Marker\Delta$  indicator reads the difference in amplitude between the reference and active markers.

**9** Increase the RF attenuation to 10 dB:

Press Amplitude > Attenuation > 10 > dB

#### 3 Functions and Measurements

Notice the  $Marker\Delta$  amplitude readout. This is the difference of the distortion product amplitude between 0 dB and 10 dB input attenuation settings. If the  $Marker\Delta$  absolute amplitude is approximately  $\geq 1$  dB for an input attenuator change, the analyzer is generating, at least in part, the distortion.

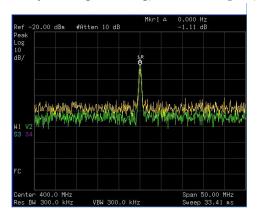

The Marker∆ amplitude readout comes from two sources:

- 1) Increased input attenuation causes poorer signal-to-noise ratio. This causes the  $Marker\Delta$  to be positive.
- 2) The reduced contribution of the analyzer circuits to the harmonic measurement causes the  $Marker\Delta$  to be negative.

Large  $Marker\Delta$  readout indicates significant measurement errors. Set the input attenuator to minimize the absolute value of  $Marker\Delta$ .


### Third-Order Intermodulation Distortion

Two-tone, third-order intermodulation distortion is a common specification in communication systems. When two signals are present in a non-linear system, they may interact and create third-order intermodulation distortion (TOI) products that are located close to the original signals. System components such as amplifiers and mixers contribute to the generation of these distortion products.

For an example of the quick setup of TOI measurement, refer to "Intermod (TOI)" on page 130.

This example will test a device for third-order intermodulation through the use of markers. Two sources are used, one set to 300 MHz and the other to 301 MHz.

1 Connect the equipment as shown in figure below. This combination of signal generators, low pass filters, and directional coupler (used as a combiner) results in a two-tone source with very low intermodulation distortion. Although the distortion from this setup may be better than the specified performance of the analyzer, it is useful for determining the TOI performance of the source/analyzer combination. After the performance of the source/analyzer combination has been verified, the device-under-test (DUT) (for example, an amplifier) would be inserted between the directional coupler output and the analyzer input.

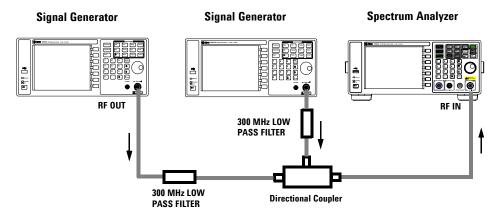

#### NOTE

The coupler should have a high degree of isolation between the two input ports so the sources do not intermodulate.

- 2 Set one source (signal generator) to 300 MHz and the other source to 301 MHz, for a frequency separation of 1 MHz. Set the sources equal in amplitude as measured by the analyzer (in this example, they are set to -5 dBm).
- **3** Set the analyzer center frequency and span:

Press | Preset | Preset (With Preset Type of Factory)

Press Frequency > Center Freq > 300.5 > MHz

Press SPAN > Span > 5 > MHz

4 Reduce the RBW until the distortion products are visible:

Press BW/ and 🗗

**5** Move the signal to the reference level:

Press Peak

Press Marker > Mkr -> Ref Lvl

6 Reduce the RBW until the distortion products are visible:

Press BW/ and 🗗

7 Activate the second marker and place it on the peak of the distortion product (beside the test signal) using the Next PeaK:

Press Marker > Delta > Delta (On)

Press Peak > Next Peak

8 Measure the other distortion product:


Press Marker > Normal

Press Peak > Next Peak

**9** Measure the difference between this test signal and the second distortion product (see Figure 17):

Press Marker > Delta > Delta (On)
Press Search > Next Peak

Figure 17 Measuring the Distortion Product

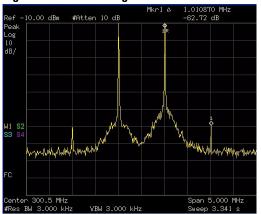

3

# **Measuring Phase Noise**

Phase noise is a frequency domain measure of stability. Phase noise is specified as single-sideband power in relation to the fundamental RF output frequency. It is measured at various offset frequencies from the carrier, normalized to a 1 Hz measuring bandwidth.

In this example the 50 MHz amplitude reference signal is used as the fundamental signal.

- 1 Press | Preset | Preset (With Preset Type of Factory)
- 2 Connect a cable from the front panel CAL OUT to RF IN.

Press Preset > Alignment > CAL OUT On


- 3 Press Auto to auto-tune the signal to the center of display.
- 4 Press Peak to place a marker on the peak of the signal.
- **5** Turn on the phase noise function to view the results:

Press Marker > Function > Phase Noise > Phase Noise (On)

**6** Change the offset:

Press Marker > Function > Phase Noise > Offset Manual

Then select the offset by pressing the corresponding softkeys under the **Phase Noise** menu.

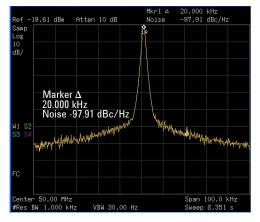


# **Stimulus Response Transmission**

The procedure below describes using the built-in tracking generator of the analyzer to measure the rejection of a low pass filter. A type of transmission measurement.

1 To measure the rejection of a low pass filter, connect the equipment as shown in Figure 18. A 370 MHz low pass filter as the DUT.

Figure 18 Transmission Measurement Test Setup

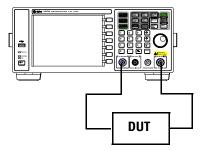

- 2 Press Preset > Preset. (With Preset Type of Factory)
- 3 Set the start and stop frequencies and resolution bandwidth:

Press Frequency > Start Freq > 100 > MHz

Press Frequency > Stop Freq > 1 > GHz

Press Bw > 3 > MHz

4 Turn on the tracking generator and if necessary, set the output power to -10 dBm:

Press  $\blacksquare$  > Tracking Generator > Amplitude TG(0n) > -10 > dBm

CAUTION

Excessive signal input may damage the DUT. Do not exceed the maximum power that the device under test can tolerate.

#### 3 Functions and Measurements

NOTE

To reduce ripples caused by source return loss, use 6 dB or greater output attenuation. Tracking generator output attenuation is normally a function of the source power selected. However, the output attenuation may be controlled in the Tracking Generator menu.

**5** To increase measurement sensitivity and smooth the noise:

Press | Res Bw > 30 > KHz

Press | W > Video Bw > 300 > KHz

A decrease in displayed amplitude is caused by tracking error.

**6** Use peak tracking to correct the frequency offset:

Press Mode > Tracking Generator > More > Tracking Peak

Tracking error occurs when the output frequency of the tracking generator is not matched to the input frequency of the analyzer. The amplitude should return to the value that was displayed prior to the decrease in resolution bandwidth.

7 Connect the cable from the tracking generator output to the analyzer input. Store the frequency response in trace 3 and normalize:

Press Mode > Tracking Generator > More > Normalize > Store Ref (1  $\rightarrow$  3) > Normalize (On)


**8** Reconnect the DUT to the analyzer and change the normalized reference position:


Press Mode > Tracking Generator > More > Normalize > Norm Ref Posn > 8

**9** Measure the rejection of the low pass filter:

Press Marker > Normal > 370 > MHz, Delta > 160 > MHz

The marker readout displays the rejection of the filter at 160 MHz above the cutoff frequency of the low pass filter. See Figure 19 as below.

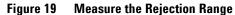

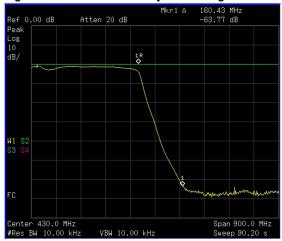


# **Measuring Stop Band Attenuation of a Lowpass Filter**

When measuring filter performance, it is useful to look at the stimulus response over a wide frequency range. Setting the analyzer y-axis (amplitude) to Log scale type presents the measurement data in a usable format for determining filter characteristics.

The following example uses the tracking generator to measure the stop band attenuation of a 370 MHz low pass filter.

1 To measure the response of a low pass filter, connect the equipment as shown in Figure 20. This example uses a 370 MHz low pass filter.

Figure 20 Transmission Measurement Test Setup

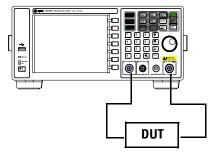

- 2 Press Preset > Preset. (With Preset Type of Factory)
- **3** Set the start and stop frequencies and resolution bandwidth:

**4** Set the resolution bandwidth to 10 kHz:

Press | SW | > Res Bw > 10 > KHz

### CAUTION

Excessive signal input may damage the DUT. Do not exceed the maximum power that the device under test can tolerate.

5 Turn on the tracking generator and, if necessary, set the output power to -10 dBm:

 ${\rm Press} \ \, \boxed{\hspace{.5cm} \text{MODE}} \ \, > \text{Tracking Generator} > \text{Amplitude TG(On)} > \text{-10} > \text{dBm}$ 

**6** Connect the test cable (but not the DUT) from the tracking generator output to the analyzer input. Store the frequency response into trace 3 and normalize:

Press MODE > Tracking Generator > More > Normalize > Store Ref (1  $\rightarrow$  3) > Normalize (On)

- **7** Reconnect the DUT to the analyzer. Note that the units of the reference level have changed to dB, indicating that this is now a relative measurement.
- **8** To change the normalized reference position:

Press Mode > Tracking Generator > More > Normalize > Norm Ref Posn > 8

**9** Place the reference marker at the specified cutoff frequency:

Press Marker > Delta Pair (Ref) > 370 > MHz

10 Place the second marker at 37 MHz:

Press Marker > Delta Pair (Delta) > 37 > MHz

#### 3 Functions and Measurements

- In this example, the attenuation over this frequency range is -17.98 dB/octave (one octave above the cutoff frequency).
- 12 Use the front-panel knob to place the marker at the highest peak in the stop band to determine the minimum stop band attenuation. In this example, the peak occurs with Delta of 563 MHz. The attenuation is -60.93 dB. See Figure 21.



Figure 21 Minimum Stop Band Attenuation


# **Making a Reflection Calibration Measurement**

The following procedure makes a reflection measurement using a coupler or directional bridge to measure the return loss of a filter. This example uses a 370 MHz low pass filter as the DUT.

The calibration standard for reflection measurements is usually a short circuit connected at the reference plane (the point at which the device under test (DUT) is connected.) See Figure 22, a short circuit has a reflection coefficient of 1 (0 dB return loss). It reflects all incident power and provides a convenient 0 dB reference.

1 Connect the DUT to the directional bridge or coupler as shown in Figure 22. Terminate the unconnected port of the DUT.

Figure 22 Reflection Measurement Short Calibration Test Setup

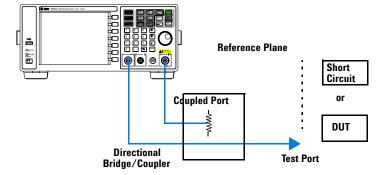

#### NOTE

For greatest accuracy, use a coupler or bridge with the correct test port connector. Any additional adapters or components placed between the test port and DUT degrades coupler/bridge directivity and system source match.

For best results, use the same adapter for the calibration and the measurement. Be sure to terminate the second port of a two port device.

- **2** Connect the tracking generator output of the analyzer to the directional bridge or coupler.
- **3** Connect the analyzer RF input to the coupled port of the directional bridge or coupler.
- 4 Press Preset > Preset. (With Preset Type of Factory)
- 5 Turn on the tracking generator and, if necessary, set the output power to -10 dBm:

Press MODE > Tracking Generator > Amplitude TG (On) > -10 > dBm

### **CAUTION**

Excessive signal input may damage the DUT. Do not exceed the maximum power that the device under test can tolerate.

**6** Set the start and stop frequencies and resolution bandwidth:

**7** Replace the DUT with a short circuit.

**8** Normalize the trace:

Press Mode > Tracking Generator > More > Normalize > Store Ref (1 → 3) > Normalize (On)

This activates the trace 1 minus trace 3 function and displays the results in trace 1 (Figure 23). The normalized trace or flat line represents 0 dB return loss. Normalization occurs each sweep. Replace the short circuit with the DUT.

NOTE

The reference trace is stored in trace 3, changing trace 3 to Clear Write will invalidate the normalization.

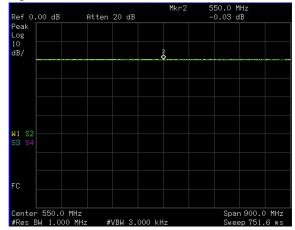


Figure 23 Short Circuit Normalized

# **Measuring Return Loss Using the Reflection Calibration Routine**

This procedure uses the reflection calibration routine in the proceeding procedure "Making a Reflection Calibration Measurement" on page 62 to calculate the return loss of the 370 MHz low pass filter.

- 1 After calibrating the system with the above procedure, reconnect the filter (DUT) in place of the short circuit used for calibration. Do not change any of the analyzer settings or the measurement setup may be invalidated.
- **2** Use the marker to read return loss. Position the marker with the front-panel knob to read the return loss at that frequency.

Rotate the knob to find the highest peak and the readout is the maximum return loss. See Figure 24.

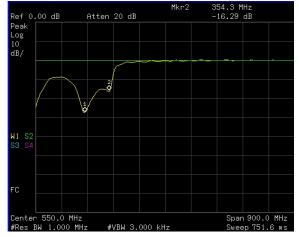


Figure 24 Measuring the Return Loss of the Filter

# **Viewing Catalogs and Saving Files**

The analyzer will store and retrieve data files similar to using a PC. The analyzer allows you to view and save files in the internal storage of the analyzer or to a USB storage device. This section provides information on how to locate catalogs (file types) and to save files.

### **Locating and Viewing Files in the Catalog**

The analyzer has four types of files:

**State** stores analyzer settings (file extension: .STA).

**Trace** stores trace information (file extension: .TRA).

**Screen** stores screen captures of the display (file extension: .JPG).

which stores data sets to determine whether a trace has

exceeded preset specifications (file extension: .LIM).

NOTE

Limits

Trace files are not bitmap files. They cannot be imported into other applications or converted. If you require the use of other applications, be sure to save as .JPG formats using **Screen** for your file type.

Press File > Catalog to bring up a screen display below.



#### 3 Functions and Measurements

1 The entry fields show the parameters for the files viewed:

Name states the filename.

**Type** displays the type of files viewed.

**Path** displays the location of the files (Local or USB).

**2** There are four column headings in this area of the display:

Name displays the filename.

Type displays the filename extension (TRA, STA, TRC or JPG).

**Size** displays the size of the file in bytes.

**Modified** displays the date and time the change occurred.

**3** The softkey menu has four options:

**Type** selects the type of file you wish to view.

**Sort** sorts and views the files according to a file attribute.

**Local** accesses the internal storage to view files.

USB accesses the external USB storage device to view files.

**4** The drive space line shows the number of bytes used on the drive and the number of bytes still free on the drive.

### Saving a File

The analyzer can save files (states, traces, limits or screens) to a USB storage device (USB/), or internal storage (Local/). The following is an example of how to save a trace to internal storage (Local/).

1 Select the save destination for the file. This example will select the internal storage (**Local**/):

Press File > Catalog > Local

- 2 Press Return > Save, to access the Save menu.
- **3** Select the type of file. In this example we will save a trace. The filename extension for the trace file type is .TRA:

Press Type > Trace

**4** Select the trace to save (1, 2, 3, 4 or all traces). For this example, we will select trace 3:

#### Press Source > Trace 3

5 Enter a filename by pressing Name. Assume you name the file "TEST1". The alpha portion of the filename is selected using the softkey menus. The numeric keypad is used for the numeric portion of the filename. Press Enter to accept the filename and to terminate this process and return to the Save menu.

The filename can be composed of alpha (A-Z) or numeric (0-9) characters in any combination. The analyzer will not overwrite an existing file. If the filename already exists, the status bar will display the message: "File already exists". If a filename is not edited, the analyzer will automatically generate a name based on the type of file you are saving (State: STATE, Trace: TRACE, Limits: LIMIT, Screen: SCREN). It also generates a three digit integer, starting at 000 and extending through 999, which it adds to the name, for example: TRACE056.TRC. The analyzer will remember the previously saved value even through a power cycle.

**6** Press **Save Now** to save the file

"Saving Now" is displayed during this operation. In this example, the status bar displays "Local/TEST1.TRC file saved".

CAUTION

When saving a file to a USB storage device, do not disconnect the USB device during the save operation. To do so may cause unexpected data loss.

3

# Loading a File

This feature will recall (load) onto the displayed screen a previously saved filename and type compatible with this analyzer. The file types are described above.

- 1 Select the directory where your file is located. In this example, select the internal storage (Local/):
  - Press File > Catalog > Local
- 2 Press Return > Load to access the Load menu
- 3 Select the type of file. Assume you need to load a trace file: Press Type > Trace
- 4 Using the knob or arrow keys to highlight the file you need. And then select the trace into which you wish to load the file. Assume you need to load file TEST1.TRC into Trace 2: Press Destination > Trace 2.
- Fress Load Now to load the specified file. The status bar displays: "Local/TEST1.TRC file loaded".
  Screen files are in .jpg format and cannot be loaded or recalled into the analyzer display, they can only be downloaded and used in PC applications.

### Copying a File

To copy a file from internal storage to a USB storage device, follow this procedure:

- 1 Press File > Catalog > Local to select the path
- 2 Connect a USB storage device to the USB connector (DEV).
- 3 Select the type of file. Assume you need to copy a trace file: Press Return > Copy > Type > Trace
- 4 Using the knob or arrow keys to highlight the file name you need. In this example, highlight the file TEST1.TRC.
- **5** Press **Copy Now** to execute the operation. A "Copying file" indicator displays. Then "/USB/TEST1.TRC file copied" appears on the status bar. You have now copied the file TEST1.TRC from the internal storage to the USB storage device.

### **Deleting a File**

Perform the following process to delete a specific file. Note that once a file is deleted from local memory, it cannot be recovered.

- 1 Press File > Catalog > Local to select the path
- 2 Press Return > Delete to access the Delete menu
- 3 Select the type of file. Assume you need to delete a trace file press Type > Trace
- 4 Using the knob or arrow keys to highlight the file name you want to load. In this example, selecting the file TEST1.TRC.
- **5** Press **Delete Now**. "Deleting file" indicates the operation is in process. Then, "Local/TEST1.TRC file deleted" shown on the status bar indicates the file has been deleted.

Functions and Measurements

Agilent N9320A Spectrum Analyzer
User's Guide



**Key Reference** 

```
Amplitude
            72
Auto Tune
            75
Back <-
          76
BW/Avg
           77
Det/Display
              81
Enter
        87
File/Print
            88
Frequency
            95
Marker
Marker->
           101
        102
Meas
MODE
         103
Peak Search
              107
Preset/System
                 111
SPAN
        117
Sweep/Trig
              118
View/Trace
             120
```

This chapter describes each front panel hardkey and their associated softkeys (menus). The front panel key descriptions are organized alphabetically. The lower level softkeys are listed as they appear in the softkey menus.

## **Amplitude**

Press Amplitude hardkey to activate the reference level function and access the amplitude softkey menu.

The softkey menu selections are described as follows:

Ref Level

Softkey sets the reference level. This function is activated when Amplitude is pressed. The reference level is the amplitude power or voltage represented by the top line of the graticule on the display. Setting the reference level changes the absolute amplitude level (in the selected amplitude units) of the top graticule line.

Key access: Amplitude

Attenuation Auto Man Softkey toggles the input attenuation between **Auto** and **Man**. The attenuation level can be set in as little as 1 dB increments when **Man** is selected. The analyzer input attenuator is normally coupled to the reference level control, it reduces the power level of the input signal at the input mixer. Selecting **Auto** re-couples the attenuator. Change the attenuation by using the arrow keys, the knob, or the numeric keypad.

Key access: Amplitude

Scale/Div

Softkey sets the logarithmic units per vertical graticule division on the display. The **Scale/Div** function is available only when the **Scale Type** key is set to **Log**.

Key access: Amplitude

Scale Type Log Lin Softkey scales the vertical graticule divisions in logarithmic units when **Log** is selected. The valid logarithmic units are 1, 2, 5 and 10 dB per division. When **Lin** is underlined, the vertical divisions are linearly scaled with default amplitude units of volts. The top of the graticule represents the reference-level value; the bottom of the graticule represents zero volts. (Each division is one-tenth of the reference level.)

Key access: Amplitude

#### Int Preamp On Off

(Option PA3) Softkey toggles the internal pre-amplifier function between on and off. Pressing Int Preamp (On) results in a correction being applied to compensate for the gain of the preamp. Amplitude readings then represent the signal value at the input connector. When the preamp is on, a "PA" indication appears on the left side of the display. The preamp operates over a range of 100 kHz to 3 GHz.

Key access: Amplitude

Y Axis

Softkey accesses the softkeys that change the amplitude units (logarithmic or linear). Change the amplitude units by pressing dBm, dBmV, dBuV, dBuA, Watts, Volts, and Amps.

Key access: Amplitude > More 1 of 2 >

#### Ref Lvl Offset

Softkey adds an offset value to the displayed reference level. Reference-level offsets are only entered by using the numeric keypad. Entering an offset does not affect the trace or the attenuation value. Reference-level offsets are used when gain or loss occurs between a device under test and the analyzer input. Thus, the signal level measured by the analyzer may be referred to as the level at the input of an external amplitude-conversion device. When an amplitude offset is entered, its value appears on the left side of the display under Offst (as opposed to frequency offsets which appear at the bottom of the display). To eliminate an offset, press  $Ref \ Lyl \ Offst > 0 > dB$ .

Key access: Amplitude > More 1 of 2 >

#### Ext Amp Gain

Softkey adds a positive or negative preamplifier gain value, which is subtracted from the displayed signal. (Use negative values for gain and positive values for loss.) The function is similar to the **Ref Lvl Offset** function, however with the **Ext Amp Gain** function, the attenuation may be changed depending on the preamplifier gain entered. A preamplifier gain offset is used for measurements that require an external preamplifier or long cables. The offset is subtracted from the amplitude readout so that the displayed signal level represents the signal level at the input of the preamplifier. The preamplifier gain offset is displayed at the top of the screen and is removed by entering zero. The preamplifier gain offset can only be entered using the numeric keypad. The preamplifier gain value is not affected by an instrument preset or a power cycle.

Key access: Amplitude > More 1 of 2 >

### **Auto Tune**

Hardkey activates the autotune function to view the signal, This hardkey performs the following functions automatically:

- 1 Run Peak Search in full span
- 2 Run Mkr -> CF
- **3** Select the appropriate reference level according to the amplitude of searching signal.
- **4** Set span to 1 MHz and all auto couple to view the signal.

NOTE

The Auto Tune functions in the frequency range of 5 MHz to 3 GHz. The minimum detectable amplitude is -65 dBm.

For more information about **Peak Search**, **Mkr->CF** and **Mkr->Ref Lvl** softkeys, refer to "Peak Search" on page 109, and "Marker->" on page 103.

### Back <-

The backspace hardkey is located in the numeric keypad area of the front panel and is used to change or correct an active function entry, or to change a text entry before you save data to a file.

# BW/Avg

Hardkey activates the resolution bandwidth function and accesses the softkey menus that control the bandwidth and averaging functions.

#### Res BW Auto Man

Softkey controls the 3 dB resolution bandwidth of the analyzer from 10 Hz to 3 MHz using the knob or arrow keys. There are four available bandwidths less than 1 KHz are 10, 30, 100 Hz or 300 Hz. If an invalid bandwidth is entered using the numeric keypad, the analyzer chooses the closest acceptable bandwidth. As the resolution bandwidth is decreased, the sweep time is modified in order to maintain amplitude accuracy. Resolution bandwidth is also coordinated with the frequency span. As the span is decreased, the resolution bandwidth decreases. When the VBW/RBW is set to **AUTO**, if the resolution bandwidth changes, the video bandwidth changes to maintain the VBW/RBW ratio.

A "#" mark appears next to "Res BW" on the display when it is not coupled. To recouple the resolution bandwidth, press Res BW (Auto).

Key access: BW/



### Video BW Auto Man

Softkey changes the analyzer post-detection filter from 1 Hz to 3 MHz using the knob or arrow keys. If an invalid bandwidth is entered, the analyzer chooses the closest available bandwidth. As the video bandwidth decreases, the sweep time will increase to maintain amplitude accuracy.

A "#" mark appears next to "VBW" on the bottom of the analyzer display when it is not coupled. To couple the video bandwidth, press Video BW (Auto).


Key access: BW/



#### VBW/RBW Auto Man

Sets the ratio between the video and resolution bandwidths. When a signal is weak and is visually masked by the noise floor, set the ratio to less than 1 to lower the noise. When the Preset Type is set to Factory and Preset is pressed, the ratio is set to 1. Change the ratio by using the arrow keys, knob, or numeric keypad. When VBW/RBW (Auto) is selected, the ratio is determined automatically by the rules in Figure 25.

Figure 25 **VBW/RBW Ratio Auto Rules** 

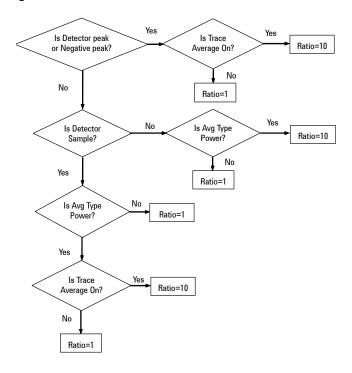

Key access: BW

#### Average On Off

Initiates a digital averaging routine that averages the trace points in a number of successive sweeps resulting in trace "smoothing". The number of sweeps (average number) is changeable when setting **Average (Off)**. Increasing the average number will further smooth the trace. pressing **BWI** > **Avg Type** to select the type of averaging.

To restart averaging:

- Enter a new average number
- Change any related parameter (e.g., Center Frequency)

When in **sweep single**, the specified number of averages is taken, then the sweep stops and an average trace displayed.

When in continuous sweep mode, the specified number of averages is taken, then the averaging continues with each new sweep averaged in with a weight of  $\frac{1}{\text{AverageNumber}}$  and the old average reduced by multiplying it by

$${\sf AverageNumber} - \frac{1}{{\sf AverageNumber}}$$


To turn averaging off, press Average (Off).

Key access: BW/

#### Avg Type Auto Man

Toggles the average type between automatic and manual. Selecting **Auto** sets the analyzer to automatic averaging by the rules in Figure 26.

Figure 26 Auto Rules for Average Type

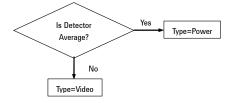

Selecting Man sets the analyzer to manual averaging.

When trace average is on, the average type is shown on the left side of the display. Selecting an average type manually causes the analyzer to use that type without regard to other analyzer settings and sets **Avg Type** to **Man**.

Key access: BW/ Avg

Video Avg Video averaging averages the data as appropriate for the y-axis scale. When Avg Type > Video Avg is selected, "VAvg" appears on the left side of the analyzer display if Average is On.

Key access: | SW| > Avg Type

Key access:  $\frac{BWI}{Avg}$  > Avg Type

Pwr Avg Power averaging is performed by converting the trace data from logarithmic to linear power units, and then averaging the power trace data. When Avg Type > Pwr Avg is selected, "PAvg" appears on the left side of the screen if Average is On.


### **Det/Display**

Detector (detector type) Auto Man Press this hardkey to control detector and display functions.

Softkey presents a submenu to select a specific detector type, or allows the analyzer to select the appropriate detector (select **Auto**) for a particular measurement.

Regarding detectors, it is important to understand what is a trace "bucket". For every trace point displayed, there is a finite time during which the data for that point is collected. The analyzer looks at all of the data collected during that time and present a single point of trace data based on the detector mode. The interval during which the data for that trace point is being collected, is called the "bucket".

Figure 27 Detector (auto) Selection Flowchart Rules

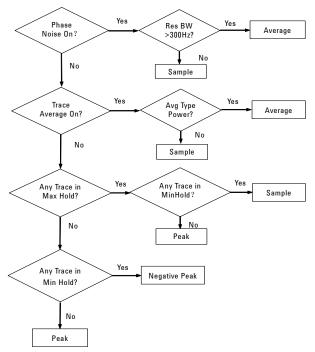

Thus a trace is more than a series of single points. It is actually a series of trace "buckets". The data may be sampled many times within each bucket.

When the detector is set to Auto, Pressing [W. > Average (On) changes the detector. The **Auto** choice will depend on marker functions, trace functions, and the trace averaging function. If a marker function or measurement is running, the **Auto** choice of detector is either Average or Sample. When one of the detectors (such as **Average**) is manually selected instead of Auto, that detector is used without regard to other analyzer settings.

- Average displays the power average in the bucket.
- Sample displays the instantaneous level of the signal at the center of the bucket represented by each display point.
- **Positive Peak** displays the max. of the signal in the bucket.
- **Negative Peak** displays the min. of the signal in the bucket.

The detector in use is indicated on the left side of the display. A "#" will appear next to it if the detector has been manually selected.

Key access: Det/



Auto

Selects peak detection as the default. If a different detection scheme would be better utilized for a particular measurement, the analyzer will use the alternate detection method. Key access: Det( > Detector Auto Man

**Positive** Peak

Obtains the maximum video signal between the last display point and the present display point and stores this value in memory. It's used primarily when measuring sinusoidal components. When **Positive Peak** is selected, "Peak" appears in the upper-left corner. Key access: Det/Display > Detector Auto Man

Negative Peak

Is a peak detector, but selects the minimum video signal value. This detection should not be used to measure the accurate amplitude. "NPk" also appears in the upper-left corner, When **Negative Peak** is selected.

Key access: Detector Auto Man

Average Video RMS measures the average value of the amplitude across each trace interval (bucket). When **Average** is selected, "Avg" appears on the left

corner.

Key access: Det > Detector Auto Man

Sample

Sample detection is used primarily to display noise or noise-like signals. It should not be used to measure the accurate amplitude of non noise-like signals. In sample mode, the instantaneous signal value of the present display point is placed in memory. When **Sample** detection is selected, "Samp" appears in the upper-left corner of the display.

Key access: Det > Detector Auto Man

Normal

Selects the maximum and minimum video signal values alternately. When selecting **Normal** detection, "Norm" appears in the upper-left corner.

Key access: Det/ > Detector Auto Man

Active Fctn Position

Selects the screen position for the Active Function Display. Depending on the type of trace data being viewed, you can move the Active Function Display position to minimize its visual interference with your screen data.

Key access: Det/Display

Top Displays the active function in the top-left cor-

ner of the display.

Key access: Det > Active Fctn Position

**Center** Displays the active function in the center-left

side of the display.

Key access: Det/Display > Active Fctn Position

**Bottom** Displays the active function in the bottom-left

corner of the display

Key access: Det > Active Fctn Position

### **Display Line** On Off

Activates an adjustable horizontal line that is used as a visual reference line. The line, which can be used for trace arithmetic, has amplitude values that correspond to its vertical position when compared to the reference level. The value of the display line appears in the active function block and on the left side of the display. Use the arrow keys, knob, or numeric keypad to adjust the display line. Pressing any digit, 0 through 9, on the numeric keypad brings up the selected terminator submenu.

Key access: Det/

#### Limits

Accesses softkeys that allow you to control and define the parameters of limit lines.

Key access: Det/

**Limit 1** selects either of the available limits. The **Limit 1** and **Limit 2** Limit 2 keys access softkeys to set parameters for the selected limit.

Key access: Det/ > Limits

Type

defines the limit to be edited as an upper **Upper lower** or lower limit. An upper limit will

> indicate a fail if trace 1 exceeds this limit. A lower limit will indicate a fail if trace 1 falls below the limit.

Key access: Det/Display > Limits > Limit 1/2

#### Limit On Off

Toggles the limit line function to on or off. The limit points must exist before the limit function can be turned on. Either **Limit** or **Margin**, as well as **Test**, must be turned on for a limit test. Limit points must be defined before the Limit function can be turned on.

Key access: Det > Limits > Limit 1/2

#### Test On Off

Toggles the testing of the limit lines between on and off. If trace 1 is at or within the bounds of the set limit or margin, "Limit\_# Pass" or "Margin\_# Pass" is displayed in the upper left corner of the measurement area limit line. Only positive/negative margins are allowed for lower/upper limits. If the trace is out of the limit or margin boundaries, "Limit\_# Failed" or "Margin\_# Failed" is displayed. Either Limit or Margin must be turned on for test.

Key access: Det > Limits > Limit 1/2

#### Margin On Off

Toggles the margin function to on or off. Use Margin to set a limit line offset for the selected limit line. Either **Limit** or **Margin** as well as **Test**, must be turned on for a limit test to work.

Key access: Det/Display > Limits > Limit 1/2

Edit

Accesses the submenu to edit the limit point, and also accesses the limits table. Use arrow keys to move between the rows in the limits table. New limit segments will only be applied after close the editor. Pressing **Return**, or any key not associated with the editor, will close the editor.

Key access: Det/Display > Limits > Limit 1/2

#### **Point**

Creates or edit a limit point. Up to 20 points can be defined for each limit line. Enter the point number using the numeric keypad, then Press [Enter], or use the knob or arrow keys to move to an existing point.

Key access: Det/Display > Limits > Limit 1/2 > Edit

#### Frequency

Edits the frequency value for a limit point. After editing, the limit table will place the frequency or time in correct order. For a new point, the **Amplitude** default is 0 dBm, and **Connected** default is **Yes**.

Key access: Det Det Det Display > Limits > Limit 1/2 > Edit

#### **Amplitude**

Sets the amplitude value for the current point.

Key access: Det > Limits > Limit 1/2 > Edit

### Connected To Previous Pt

#### Yes No

Defines if the current point being edited is to be connected to the previous point. Pressing this key toggles the **Connected** value between **Yes** and **No**.

Key access: Det/ > Limits > Limit 1/2 > Edit

#### **Delete Point**

Deletes the current point in the limit line. Pressing this key will delete the point immediately.

Key access: Det/Display > Limits > Limit 1/2 > Edit

**Delete Limit** 

Deletes the current limit set. Pressing this key will delete the limit line entirely.

Key access: Del > Limits > Limit 1/2

Delete All Limits Purges data from the limit-line tables. Pressing this key will delete all the limit line data immediately.

Key access: Det/Display > Limits

### **Enter**

Terminates a front-panel keypad numeric entry and enters that value into the analyzer. (For most applications, it is better to use the units softkeys to terminate value entry.) When in **File** menu, the **[Enter]** key is used to terminate filename entries.

### File/Print

Hardkey accesses the softkeys menus to manage the file system of the analyzer. Refer to "Viewing Catalogs and Saving Files" on page 66, for more information.

Catalog Displays all files located on the selected catalog, depending upon the preferences set under the Type and Sort keys defined below.

Key access: File/Print

**Type** selects all types or one type of file(s) for viewing.

Default: State

Key access: File > Catalog

**All** Displays all files and file types on the

selected drive.

Key access: File > Catalog > Type

**Screen** Displays only the screen (.JPG) files on

the selected drive.

Key access: File > Catalog > Type

**State** Displays only the state files (.STA) on the

selected drive. State files contain most

instrument settings.

Key access: File > Catalog > Type

**Trace** Displays only trace files (.TRA) on the

selected drive.

Key access: File > Catalog > Type

**Limits** Displays only the limits files (.LIM) on the

selected drive.

Key access: File > Catalog > Type

Sort Sorts the files according to a selected file attribute, including By Date, By Name, and Order Up Down. Order (Up) sorts files in ascending order (such as A, B, C). Order (Down) allows you to sort files in descending order (such as C, B, A).

Key access: File > Catalog

**Local** Accesses the internal storage of the analyzer.

Key access: File > Catalog

**USB** Accesses the external USB storage device.

Key access: File > Catalog

**Save** Accesses menu keys that allow the user to save the analyzer screen, state, trace, and limit data to a USB storage device or to the internal storage.

Key access: File/Print

Save Executes the save function. When completed, the Now message "local(USB)/XXX file saved" (where XXX is

message "local(USB)/XXX file saved" (where XXX is the filename) will appear in the status bar.

Key access: File > Save

**Type** Selects the type of data for the file save.

Key access: File > Save

**Screen** Displays all previously saved screen

files (.JPG) and captures the current screen displayed in preparation to save

it in a file (.<u>JPG</u>).

Key access: File > Save > Type

State Displays all saved state (.STA) files and

detects the current state parameters in preparation to save into a file (.STA). State files include all settings but not

traces or limits.

Key access: | Save > Type

**Trace** Displays all previously saved trace files

(.TRA) and detects the current trace in preparation to save it in a file (.TRA). Save individual traces or a group of

traces.

Key access: File > Save > Type

#### Limits

Displays all previously saved limits files (.LIM) and detects the current limits in preparation to save them in a file (.LIM). Limits provide data sets to determine whether a trace has exceeded preset specifications.

Key access: File > Save > Type

#### Source

When Type is Trace, you can select trace 1, 2, 3 or 4 in addition to the state. All Traces is selected to save all four traces in a single file, along with the state.

When Type is Limits, Source accesses the Limit 1 and 2 softkeys. Limit 1 and 2 provide data sets to determine whether a measurement trace has exceeded preset specifications.

Key access: File > Save

Name

Accesses the softkeys to enter the filename.

Key access: File > Save

#### NOTE

Only capital letters (A-Z) and digits (0-9) may appear in file names. The analyzer will automatically add the three character file extension name.

#### Load

Accesses a submenu to load analyzer states, traces and limits into the analyzer from a USB storage device or internal storage (**Local**).

Key access: File/

Load Now Executes the load file function. When load completed, the message "local(USB)/XXX file loaded" appears in the status bar (where XXX is the

filename).
Key access: File > Load

Type To selec

To select the type of file to be loaded.

Key access: File > Load

State Displays all state file types listed in

the storage location (.STA). Loading a state filetype restores most parameters

to the instrument settings.

Key access: File > Load > Type

**Trace** Displays all trace file types (.TRA).

Load traces individually or as a group. Loading a trace also loads the current state, and sets the trace to view mode.

Key access: File > Load > Type

**Limits** Displays all limits file types. The limits

data points in these files may help determine whether a trace has exceeded preset specifications (.LIM). Limits are loaded individually only.

Key access: File > Load > Type

Sort Accesses a submenu to view your saved files according to a selected file attribute. The selections include, By Date, By Name, and Order Up

**Down. Order (Up)** sorts files in ascending order (such as A,B,C). **Order (Down)** sorts files in descending order (such as C,B,A)

descending order (such as C,B,A).

Key access: File > Load

Destination With Type set to Trace, Destination directs the data to Trace 1, 2, 3 or 4. If the data is for all four traces (for instance, Source was All Traces when they were saved), the data returns to the

original trace registers.

When Type is set to Limits, Destination allows you to direct your data to Limit 1 or Limit 2.

Key access: File > Load

**Delete** Enter the submenu for deletion.

Key access: File

File/ Print

**Delete** Executes the delete file function. After a

Now successful delete, the message "local(USB)/XXX file

deleted" appears in the status bar on the display

(where XXX is the filename). Key access: File > Delete

**Type** Selects the filetype to delete.

Key access: File > Delete

**All** Displays all files for deletion.

Key access: File > Delete > Type

**Screen** Displays only screen files for deletion.

Key access:  $F_{Print}^{ile}$  > Delete > Type

**State** Displays only state files for deletion.

Key access: File > Delete > Type

**Trace** Displays only trace files for deletion.

Key access: File > Delete > Type

**Limits** Displays only limits files for deletion.

Key access: File > Delete > Type

Sorts the files according to a file attribute for

deletion: By Date, By Name and Order Up Down.

Order (Up) displays files in ascending order. Order

(Down) displays files in descending order.

Key access: File > Delete

**Copy** Enters the submenu to copy files from local to a USB storage device.

Key access: File/

**Copy** Executes the copy function. If the copy is

**Now** successful, "local/XXX file copied to USB" will appear in the status bar (where XXX is the filename).

Key access: File > Copy

**Type** Select the type of file to copy.

Key access: File > Copy

All Displays all file types.

Key access: File > Copy > Type

Screen Displays all screen files.

Key access: File > Copy > Type

**State** Displays all state files.

Key access: File > Copy > Type

**Trace** Displays all trace files.

Key access: File > Copy > Type

Limits Displays all limits files.

Key access: File > Copy > Type

Sorts the files according to a file attribute to be copied, including By Date, By Name and Order Up

Down. Order (Up) displays files in ascending order. Order (Down) displays files in descending order.

Key access: File > Copy

### Frequency

Press Frequency to activate the center frequency function, and access the menu softkeys for frequency functions. The center frequency, or start and stop frequency values appear below the graticule on the display.

NOTE

When changing both the center frequency and span, change the frequency first. The frequency value may limit the span.

Center Freq

Softkey activates the center frequency function and sets the horizontal center of the display to a specific frequency.

Key access: Frequency

Start Freq

Softkey sets the frequency starting at the left side of the graticule. The left and right sides of the graticule correspond to the start and stop frequencies.

Key access: Frequency

Stop Freq

Softkey sets the frequency at the right side of the graticule. The left and right sides of the graticule correspond to the start and stop frequencies.

Key access: Frequency

CF Step Auto Man Softkey changes the step size for the center frequency function. On selecting a step size and activating the center frequency function, the arrow keys change center the frequency by the step-size value. The step size function is useful for finding harmonics and sidebands beyond the current frequency span of the analyzer. Selecting auto-couple sets the center frequency step size to one division (10 percent of the span).

Key access: Frequency

### Signal Track On Off

Softkey moves the signal nearest the active marker to the center of the display and maintains the signal at the center of the display. "ST" will appear in the lower-left corner of the display.

Pressing Signal Track (Off); Preset (Preset Type set to Factory); or Marker > All Off will turn off the signal track function.

Toggling signal track to on and reducing the span initiates an automatic zoom and will reduce the span in steps, so that the signal remains at the center of the display. Signal track cannot be activated, if the span is set to zero.

Key access: Frequency

NOTE

If no marker is active, pressing **Signal Track (On)** activates a marker, perform a peak search, and center the marker on the display. Switching to zero span turns **Signal Track (Off)**.

### Marker

Hardkey accesses the marker control softkey menus to select the type and number of markers. Markers are shown on the display as diamond-shaped characters that identify points of traces. Up to twelve pairs of markers (when using Delta Pair markers) may appear on the display simultaneously; only one pair can be controlled at a time.

#### **Select Marker**

Selects one of the twelve possible markers. If a marker has already been selected it will become the active marker.

Key access: Marker

#### Normal

Activates a single frequency marker at the center of the active trace if not already displayed.

Displaying a marker before enabling the **Normal** function enables the marker at the position of the selected marker. The marker number shows above the marker. The knob and/or arrow keys move the marker left or right. Entering a value from the numeric keypad moves the marker to the trace point nearest to that value. Annotation in the active function block and in the upper-right corner indicates the frequency and amplitude of the marker (time and amplitude, if in zero span.) Pressing **Normal** turns off the **Delta** function and moves the active marker to the delta marker position.

Key access: Marker

#### Delta

Accesses the submenu to use the marker delta function.

Key access: Marker

### Delta On Off

**Delta (On)** activates a second marker at the position of the first marker. If no marker is present, two markers with the same identification number will appear at the center of the display. The marker number is indicated above the delta marker, and the same number is indicated with an R (for example, 1R) above the reference marker. The amplitude and frequency (or time) of the first marker is fixed.

Use the data control keys to position the delta marker. Annotation in the active function block and in the upper-right corner indicates the differences between the two markers, frequency/time and amplitude. **Delta (Off)** moves the reference marker to the active marker position, allowing you to make delta measurement from differing reference points without having to turn off the markers and begin again.

Key access: Marker > Delta

#### Delta Pair Ref Delta

Toggles the **Delta Pair** between the reference (start) and delta (stop) markers. The start marker number is indicated with a number and an R (reference) above the marker (for example, 1R). The delta marker is identified with the marker number only. Kev access: **Marker** > **Delta** 

#### Span Pair Span Center

Toggles the **Span Pair** function between the span and center markers. The start marker number is indicated with a number and an R above the marker (such as 1R) and the stop marker is indicated with only the marker number. Adjusting the span changes the frequency difference between the two markers while maintaining the midpoint at a fixed frequency. Selecting **Center** changes the center point between the two markers while maintaining the frequency difference.

Key access: Marker > Delta

#### NOTE

Ref and Delta markers maintain their displayed x-axis location, however, their frequency values will change if the frequency or span parameters that define the x-axis scale are changed. Reset these markers, if necessary, when parameters such as Span or Center Freq are changed.

Off Turns off the selected marker by the **Select Marker** key. Off also turns off the related functions such as signal track. It will also removes marker annotation from the display.

Key access: Marker

All Off Turns off all markers, including markers used for signal

track, and marker annotations.

Key access: Marker

**Function** Accesses the marker function softkeys listed below.

Key access: Marker

Freq Accesses the frequency counter function.

Counter Key access: Marker > Function

> Freq Counter Toggles the frequency counter On Off

function on and off.

**Key access:** Marker > Function > Freq Count

Resolution Toggles the frequency counter **Auto Man** resolution from manual to

> auto-couple. The allowed values are 0.1, 1, 10, 100 Hz and 1 kHz. Pressing **Auto** auto-couples frequency counter

resolution to the span.

**Key access:** Marker > Function > Freq Count

NOTE

The ratio of the resolution bandwidth to span must be greater than 0.02 for proper frequency counter function. The frequency counter will work correctly only on CW signals or discrete peaks. For an accurate reading, the marker must be >40 dB above the noise.

Phase Accesses the phase noise function softkeys.

Noise Key access: Marker > Function

> **Phase Noise** Toggles the phase noise function on

On Off and off.

**Key access:** Marker > Function > Phase Noise

**Offset** Manually sets the offset of the marker

Manual to measure phase noise.

**Key access:** Marker > Function > Phase Noise

**Offset** Sets the offset to  $\pm 1$ ,  $\pm 10$ ,  $\pm 20$ ,  $\pm 30$ ,  $\pm 50$ ,

+100 kHz or +1 MHz.

**Key access:** Marker > Function > Phase Noise

# Optimize Phase Noise

This softkey is valid only when span fall in the range of 100 Hz and 100 kHz. After enabling this softkey, the 1st LO Loop filter bandwidth will be changed from approx. 5 kHz to 120-150 kHz automatically, which optimizes the phase noise close in to the carrier.

Key access: Marker > Function > Phase Noise

#### NOTE

**Optimize Phase noise** (On) will worsen phase noise accuracy far away from the carrier. When testing phase noise far away from the carrier, select **Optimize Phase noise** (Off).

For more details on how to measure the phase noise of a signal, refer to "Measuring Phase Noise" on page 55.

#### Marker Trace Auto 1 2 3 4

Places a marker on the selected trace, if no markers have been previously turned on. If a marker is currently active, press **Marker Trace** until **1**, **2**, **3**, or **4** is underlined: the active marker moves to the selected trace.

Selecting Auto mode moves the marker to the automatically selected trace. The trace selection will search for the lowest numbered trace in the following mode order: Clear-write, Max-hold, Min-hold and View. If there are no traces in any of these modes, it selects trace 1.

Key access: Marker > More

#### **Marker Table**

Compresses the graticule and displays marker information in a table. The information includes the marker number, trace number, marker type, X axis value, and the amplitude.

Key access: Marker > More

On Activates/deactivates the marker table.

Off Key access: Marker > More > Maker Table

**Prev Page** displays the previous/next page of the marker **Next Page** table.

Key access: Marker > More > Maker Table

### Marker->

Press Marker accesses the following marker function softkeys:

Mkr → CF

Sets the frequency of the marker to the center frequency. In delta mode,  $Mkr \rightarrow CF$  sets the displayed trace center frequency to the frequency of the marker delta value.  $Mkr \rightarrow CF$  is not available in zero span.

Key access: Marker

Mkr → CF Step

Changes the center-frequency step size to match the value of the active marker. Press Frequency > CF Step to view the step size. The step size is the frequency difference between the markers when marker delta is active. Use this function to step from one signal harmonic to another.  $Mkr \rightarrow CF$  Step is not available in zero span.

Key access: Marker

Mkr → Start

Changes the display start frequency to the frequency of the active marker. In delta mode,  $Mkr \rightarrow Start$  sets the start frequency to the marker delta value.  $Mkr \rightarrow Start$  is not available in zero span.

Key access: Marker

Mkr - Stop

Changes the stop frequency to the frequency of the active marker. In Delta mode,  $Mkr \rightarrow Stop$  sets the stop frequency to the marker delta value.  $Mkr \rightarrow Stop$  is not available in zero span.

Key access: Marker

Mkr → Ref Lel

Changes the reference level to the active marker value, moving the marked point to the reference level (top line of the graticule). In delta mode,  $Mkr \rightarrow Ref Lel$  sets the reference level to the amplitude difference between the markers. (For example, if the difference is -15 dB, the reference level -15 dBm.)

Key access: Marker

## Meas

In the **Spectrum Analyer** mode (see **MODE**), **Meas** key displays a menu for measurements such as adjacent channel power, occupied bandwidth, channel power, spectrum emission mask and TOI. Refer to Chapter 5, "One-Button Measurements" for more information about these measurements. Press **Measure Off** to turn the measurement off.

### **MODE**

Selects the measurement mode of your analyzer.

**Spectrum Analyser** mode is the default mode and is for general

purpose measurement use. .

Spectrum Analyzer Selects the spectrum analysis measurement mode for the

analyzer.

Key access: Mode

Tracking Generator Accesses the tracking generator functions. (Option TG3)

Key access: MODE

Amplitude TG On Off

Activates (**0n**) or deactivates (**0ff**) the tracking generator output. The power level can then be adjusted using the numeric keypad, arrow keys or knob. Pressing any digit, 0 through 9, on the numeric keypad brings up the selected terminator menu. The output level range is -30 dBm to 0 dBm.

Key access: Mode > Tracking Generator

Attenuation

To set the output attenuation level of the tracking generator using the tracking generator output attenuator. The available level is 0 to 30 dB in 6 dB steps. The default setting is 18 dB.

Key access: MODE > Tracking Generator

Amptd Offset On Off Amptd Offset (On) allows you to offset the displayed power of the tracking generator. Using the amplitude offset capability of the tracking generator allows you to take system losses or gains into account, thereby displaying the actual power delivered to the device under test.

Key access: Mode > Tracking Generator

**Amptd Step** To set the step size of the power level range of the **Auto Man** tracking generator. The default setting is one vertical

scale division when in a logarithmic amplitude scale.

**Key access:** Mode > Tracking Generator

Power Sweep

Sweep the output offset of the tracking generator. The analyzer continues to sweep the linear change between start and stop frequency when power sweep

is on. The input range is 0 dB to 10 dB. Key access: MODE > Tracking Generator>More

Normalize Accesses the following softkeys.

Store Ref (1->3)

Copies trace 1 into trace 3. Softkey menu **Store Ref (1->3)** must be pressed before

pressing Normalize (On).

Key access: Mode > Tracking Generator >

More > Normalize

Normalize On Off Activates the normalize function. On each sweep, the normalized trace (Trace 3) is subtracted from Trace 1 and the result is added to the normalized reference level.

The trace data is normalized with respect to the normalized reference level, even if the value of the normalized reference level is changed. This function remains in effect on all subsequent sweeps until it is turned off.

The normalize function is most useful for applying correction data to a trace while making a stimulus response measurement

NOTE

Trace 1 should be in clear write mode prior to setting normalize to on.

#### 4 Key Reference

with a tracking generator. For example, connect the cables and a thru line, in place of the device to be measured, between the tracking generator and the analyzer input. Notice that the frequency response is not perfectly flat, showing the response of the cables, as well as the flatness of both the tracking generator and the analyzer. Now press Store Ref (1->3), Normalize (On). Notice that the displayed trace is now flat, or normalized. The position of the normalized trace can now be moved to a different position on the display by changing the normalized reference position. This may be useful if the device to be tested has positive gain, such as an amplifier. Now, replace the thru line with the device under test, and an accurate measurement of the gain or loss can be made.

Key access: Mode > Tracking Generator > More > Normalize

Norm Ref Lvl Sets the level (in dB) of the normalized reference.

Key access: Normalize > Tracking Generator > More

#### Norm Ref Posn

Offsets the displayed trace without affecting the instrument gain or attenuation settings. This allows the displayed trace to be moved without decreasing measurement accuracy. The normalized reference position is indicated with a (>) character on the left side of the display and a (<) character on the right side of the display.

Key access: Mode > Tracking Generator > More > Normalize

**Ref Trace** View Blank Allows you to view or blank the reference

trace on the display.

Key access: MODE > Tracking Generator > More

> Normalize

**Tracking** Peak

Activates a routine that automatically adjusts fine frequency tracking to obtain the peak response of the tracking generator on the spectrum analyzer display. Tracking Peak is performed in the current resolution bandwidth.

**Key access:** Mode > Tracking Generator > More

adj

Man Track Allows you to manually adjust the frequency of the tracking generator oscillator using the step keys, knob, or numeric keypad. The tracking adjust is tuned to maximize the amplitude of the trace.

Key access: MODE > Tracking Generator > More

NOTE

When in the Tracking Generator mode, resolution bandwidths < 1 kHz are not available.

### **Peak Search**

Places a marker on the highest peak based on the settings of the "Search Criteria" on page 110. Refer to "Peak Search Type" on page 111, for more information on the effect of settings.

NOTE

All peak search functions ignore the LO feed through signal. The process for determining if the Peak is the LO feed through takes into account Start Frequency, Span, Resolution Bandwidth, Resolution Bandwidth shape factor, and Frequency Accuracy. If there is no point of inflection within the LO feed through range, the point on the trace with maximum amplitude, that is higher in frequency than the LO feed through, will be selected.

**Peak Search** Performs peak search as described above.

Key access: Peak Search

**Next Peak** Places the marker on the next highest peak. The signal peak must exceed the peak threshold value by the peak excursion

value. If there is no peak, the marker will not move.

Key access: Peak Search

Next Pk Right

Moves the marker to the next peak to the right of the current marker position. The signal peak must exceed the peak threshold value by the peak excursion value. If there is no peak to the right, the marker will not move and the "No Peak Found" error message will appear on the display.

Key access: Peak Search

Next Pk Left Moves the marker to the next peak to the left of the current marker position. The signal peak must exceed the peak threshold value by the peak excursion value. If there is no peak to the left, the marker will not move and the "No Peak Found" error message will appear on the display.

Key access: Peak Search

Min Search Moves the active marker to the minimum detected amplitude.

Key access: Peak

**Pk-Pk Search** Finds and displays the frequency (or time, if in zero span), and amplitude differences between the highest and lowest

trace points.

Key access: Peak

Continuous Pk On Off

When **Continuous Pk** is **on**, the marker will remain on the peak signal even if the frequency of that signal changes. The marker will remain on that signal as long as the amplitude of the signal does not change by more than 3 dB from one sweep to another.

If the signal is lost, the marker will attempt to find it again and maintain on the peak. If there are other signals on screen near the same amplitude, one of them may be found instead. Signals near 0 Hz cannot be maintained effectively.

This function is intended to maintain the marker on signals with a frequency that is changing, and an amplitude that is not changing.

Key access: Peak > More

N dB Points On Off Activates the N dB function. Pressing **N dB Points (On)** activates two arrows that are N dB down from the marker. The frequency difference between the two arrows will be displayed in the upper right-hand corner of the display.

Key access: Peak Search > More

Search Criteria Accesses the submenu to set the criteria for peak search.

Key access: Peak Search > More

#### 4 Key Reference

#### **Peak Excursion**

Sets the minimum amplitude variation of signals that the marker identifies as a peak. If a value of 10 dB is selected, the marker moves only to peaks that rise and fall more than 10 dB above the peak threshold value. When the peak excursion is 6 dB or higher,

#### NOTE

Two signal peaks, which are so close together that the amplitude drop between them is less than the peak-excursion value, are not recognized as two peaks. A signal peak is recognized only if it has a peak excursion drop above the noise floor, on both sides of the signal.

the marker-peak does not recognize signals less than peak-excursion value above the noise floor. To correct this, when measuring signals near the noise floor, reduce the excursion value. To prevent the marker from identifying noise as signals, reduce the noise floor variance less than the peak-excursion value by reducing the video bandwidth or by using video averaging.

Key access: | Peak | > More > Search Criteria

#### Peak Threshold

Sets the minimum amplitude that the marker can identify as a peak. For example, if set to -90 dBm, the marker moves only to peaks that rise and fall more than the peak excursion above -90 dBm. Only functional when in Excursion and Threshold marker mode.

Key access: | Peak | > More > Search Criteria

#### Threshold Hidden

Hides the threshold line from being displayed on the screen.

Key access: Peak Search Criteria

Peak Search Type Selects the peak search mode.

Key access: Peak Search Criteria

Max Value A Peak search with Max Value type places a marker on the highest peak, excluding the LO feedthrough peak. Key access: | Peak | > More > Search

Criteria > Peak Search Type

**Excursion & When Peak Search Type is Excursion &** Threshold Threshold, a peak search places a

marker on a peak that meets the Peak Excursion and Peak Threshold parameters. If **Peak Search Type** is **Excursion & Threshold** and no peak satisfies the selected parameters, a marker is placed at the center of the trace, and the error message, "No Peak Found" will appear. Key access: Peak Search > More > Search Criteria > Peak Search Type

**Peak Table** Accesses the following **Peak Table** softkeys to set a peak table.

Key access: | Peak | > More

**Peak Table** On Off

Displays a list of up to 12 signal peaks that is updated at the end of each sweep. The peak table function works with trace 1 only. Key access: Peak Search > More > Peak Table

**Peak Sort** Freq Amptd Switches the peak table sorting routine between listing the peaks in order by descending amplitude or frequency. Key access: Peak Search > More > Peak Table

# **Preset/System**

Accesses the Preset and System softkeys. When the analyzer is in the remote mode, pressing Preset returns the analyzer to the local controlmode and enables front-panel inputs.

Preset

Provides a known state of the instrument for making measurements. The analyzer allows you to select whether a user preset, or factory preset is performed.

If **Preset Type** is set to **Factory**, pressing **Preset Preset** performs a factory preset, which performs the following:

- Resets the analyzer to Spectrum Analyzer (SA) mode
- Brings up the Frequency menu
- Sets certain conditions to their default values
- Clears both the input and output buffers and clears all trace data
- Sets the amplitude values of trace 2, 3 and 4 to the bottom of the screen
- Turn amplitude-correction factors off, but remain in analyzer memory
- Turn limit line testing off, but the limit line tables remain in analyzer memory

See Table **Factory Preset States** as follows for the conditions established by performing a factory preset.

When **Preset Type** is set to **User**, pressing **Preset** | **Preset** | **Preset** | displays the softkeys **User Preset** and **Factory Preset**, you then select the specific preset as you need.

Key access: Preset/ System

## **Factory Preset State**

Attenuation 20 dB(Auto)		Average Type	Video (Auto)	
Center frequency	nter frequency 1.5 GHz		1(Off)	
CF step size	300 MHz	Peak Excursion	6 dB	
Start Frequency	0 Hz	Peak Threshold	-90 dBm	
Stop Frequency	3 GHz	Peak Search Type	Max Value	
Signal Track	Off	Peak Table	Off	
Span	3 GHz	Peak Sort	Amplitude	
Reference level	0 dBm	Continuous Pk	Off	
Log scale/Division	10 dB	Delta Pair	Delta	
Int Preamp	Off	Span Pair	Center	
Trace 1 Clear Write		Trigger	Free Run	
Trace 2, 3, 4	ce 2, 3, 4 Blank		Normal(Off)	
Sweep Time	Sweep Time 100.2 ms(Auto)		Off	
Sweep Continuous		Marker Table	Off	
Limit	Limit Off		Meas Off	
Limit line testing	Off	File Catalog	Local	
Limit point	0	File Type	State	
Detector	Peak(Auto)	File Sort	By Date	
Display line	-25 dBm(Off)	Phase Noise	Off	
Video bandwidth	3 MHz(Auto)	Optimize phase noise	Off	
VBW/RBW ratio	1.000 (Auto)	Frequency Counter	Off	
Resolution 3 MHz(Auto) bandwidth		Frequency counter resolution	1 kHz(Auto)	

#### 4 Key Reference

#### Pwr on/Preset

Accesses the following softkeys for the preset settings.

Key access: Preset

Power on Last Preset Determines the state of the analyzer when the analyzer is turned on. **Power On** set to **Preset** recalls the analyzer settings previously with the **Preset** function. **Power On** set to **Last** recalls the analyzer settings when previously power off.

Key access: Preset > Pwr on/Preset

**Preset Type** 

Selects  $\boldsymbol{\mathsf{User}}$  or  $\boldsymbol{\mathsf{Factory}}$  preset settings.

Key access: Preset > Pwr on/Preset

User Pressing Preset recalls the analyzer

settings defined by Save User Preset.
Key access: Preset > Pwr on/Preset >

**Preset Type** 

Factory Pressing Preset recalls the analyzer

settings originally set at the factory.

Key access: Preset > Pwr on/Preset >

Preset Type

Save User Preset Saves the active settings of the analyzer into the User Preset register. To recall these settings,

select Preset Type to User.

Key access: Preset > Pwr on/Preset

#### Alignment

Accesses the following softkeys that align the internal circuitry of the analyzer, load default values for the alignment system, and adjust the 10 MHz reference.

Key access: Preset/System

Align Accesses the Align softkeys.

Key access: Preset | > Alignment

All (Ext Cable) Initiates the alignment of systems with a cable connected from the  ${\bf CAL}$ 

**OUT** to **RF IN** (Except option TG3). Key access: Preset > Alignment > Align

CAL OUT On Off Turns the internal amplitude reference signal on or off. When this signal is on, the RF input is disabled. Key access: Present > Alignment > Align

**Timebase** 

verifies the 10 MHz reference signal setting may be adjusted for changed operating conditions, such as temperature.

Key access: Preset > Alignment

**Load Default** 

Loads the default values for the alignment system, turns on the frequency corrections, and resets the timebase to the factory values.

Key access: Preset/System > Alignment

Language

Accesses the softkeys for selecting the screen menu language.

Key access: Presett

Custom

**Diagnostics** 

Accesses the **Front Panel Test** softkey to verify the functionality of each front-panel key. The number next to each key name increments once each time the key is pressed. Rotating the knobs causes the number of pulses to be counted. Press **Return** will go back to the main menu.

Key access: Preset

**Show System** 

Displays the number and description of the options installed in your analyzer. It also displays the instrument model number, product number, serial number, the date of production, etc.

Key access: Preset > More

Show Hardware Provides detailed information about the hardware installed on the analyzer, including the model number and firmware revision.

Key access: Preset/System > More

Show Software Provides detailed information about the software installed on the analyzer.

Key access: Preset/ System > More

#### 4 Key Reference

#### **Show Errors**

Accesses a list of the 100 most recent errors reported. The most recent error will appear at the bottom of the list. The first error listed will be removed if the error list is longer than 20 entries. If the same error occurs continuously, that error message will not be added repeatedly to the list. Refer to "Instrument Messages" on page 139 for details.

Key access: Preset > More

Prev Page/ Access the previous/next page of error

Next Page messages.

Key access: Preset/ System > More > Show Errors

Clear Error Clears all the errors in the errors queue.

Queue Key access: Proset > More > Show Errors

#### Time/Date

Accesses the following **Time/Date** menu keys used to set and display the real-time clock:

Key access: Preset > More

On Off

Time/Date Toggles the time/date display between on and

off.

Key access: Preset > More > Time / Date

Date Format Changes the display format of date from MDY DMY month-day-year to day-month-year.

Key access: Preset > More > Time/Date

**Set Time** sets the time of the real-time clock. Enter the

time in 24 hour HHMMSS format. Valid hour (HH) values are from 00 to 23. Valid minute (MM) and second (SS) values are from 00 to 59.

Key access: Preset > More > Time/Date

**Set Date** sets the date of the real-time clock. Enter the

date in the YYYYMMDD format. Valid year (YYYY) values are 0000 through 9999. Valid month (MM) values are from 01 to 12, and

valid day values are from 01 to 31. Key access: Presett > More > Time/Date

#### Licensing

Accesses the security system to enable licensing for individual options. A user may not turn off an option using this system. Once an option has been licensed for a given analyzer, it cannot be transferred to a different analyzer.

Key access: Preset > More > More

#### **Option**

Allows you to key in a three-character option number. The option number will appear on the second line of the **Option** key.

Key access: Presett > More > More > Licensing

#### License Key

Allows you to key in a license key number. The license key number appears on the second line of the **License Key** softkey.

Key access: Preset > More > More > Licensing

# Activate License

Activates the license for the option whose number was previously input in **License Key**. If the entry is correct, the option will be enabled and the message: "Option activated" will appear in the status line of your display. The option number and license key numbers will also clear from the **License Key** and **Option** key.

If the entry is incorrect, the error message "License key invalid" appears in the status line of the display. Edit the option and/or license key number until they are correct.

Key access: Preset > More > More > Licensing

#### **Brightness**

Adjusts the display brightness from 1% to 100%.

Key access: Presetl > More > More

### **SPAN**

Accesses the span function and the submenu softkeys for span functions. Pressing span changes the frequency range symmetrically about the center frequency. The frequency-span readout describes the total displayed frequency range. To determine frequency span per horizontal graticule division (when the frequency scale type is set to linear), divide the frequency span by 10.

**Span** Enter the span frequency range value.

Key access: Span

Full Span Changes the span to full span showing the full frequency

range of the analyzer. Full span sets Signal Track, Marker

function off.

Key access: Span

**Zero Span** Changes the frequency span to zero. In this mode, the

current center frequency is displayed in the time domain (the x-axis is displayed in units of time), like a conventional

oscilloscope. Zero span sets Signal Track (Off).

Key access: Span

**Last Span** Changes the span to the previous span setting.

Key access: Span

# Sweep/Triq

Accesses the Sweep/Trigger softkeys for selection of the sweep mode and trigger mode of the analyzer. The softkey menu selections are defined as follows:

#### **Sweep Time** Auto Man

Selects the length of time the analyzer takes to tune across the displayed frequency span (or, in zero span, the time the analyzer takes to sweep the full screen). Reducing the sweep time increases the sweep rate. Change the sweep time by using the arrow keys, the knob, or the numeric keypad.

In non-zero spans, when the sweep time is auto-coupled, the analyzer selects the optimum (shortest) sweep time for the current settings. This selection process is influenced by several factors:

- The max, tuning rate of the spectrum analyzer
- The selected resolution and video bandwidth filters
- The max. sample rate of the analog-to-digital converter
- The number of trace points
- The amplitude scale (logarithmic or linear)
- The detector mode

The user may select a sweep time less than the auto-coupled value; however this may generate measurement errors. The minimum sweep time is 50 ms.

In zero span, the minimum sweep time is determined by the maximum sample rate of the ADC and the number of sweep points. The minimum sweep time is 2 microseconds. The maximum sweep time is 4000 seconds.

Key access: Sweep/



#### Sweep Single

Pressing **Sweep Single** puts the analyzer in single-sweep mode. Press Sweep Single to initiate a sweep when in single-sweep mode.

Key access: Sweep/



#### Sweep Cont

Selecting continuous sweep causes repeated sweeps to be triggered. Pressing **Preset** (When **Preset Type** is set to **Factory**) sets the sweep mode to continuous sweep.

#### 4 Key Reference

Key access: Sw

Free Run New sweep starts as soon as possible after the current

sweep ends.

NOTE

NOTE

Key access: Sweep/ > More

Key access: Sweep/ > More

**Video** Activates the trigger condition that starts the next sweep if the detected RF envelope voltage rises to a level set by the video trigger level. When **Video** is pressed, a line appears on the display. The analyzer triggers when the input signal exceeds the trigger level at the left edge of the display.

Change the trigger level by using the arrow keys, the knob, or the numeric keypad.

This function is not available when the Resolution Bandwidth is less than 1 kHz. Selecting a Resolution Bandwidth less than 1 kHz while in Video Trigger mode, changes the Trigger mode to Free Run.

**External Pos** Activates the trigger condition that will start a sweep when the external voltage (connected to **EXT TRG IN** on the rear

panel) passes through approximately 2 volts. The external trigger signal must be a 0 V to +5 V TTL signal. Sets the

trigger polarity to positive.

Key access: Sweep > More

**External Neg** Sets the trigger polarity to negative.

Key access: Sweep > More

**On Off**Allows you to set and turn on or off an offset value from the trigger point of the sweep at which to begin storing data in the trace of the analyzer. The offset is specified as a function of time, and permits positive (pre trigger) and negative (post trigger) values to be specified.

Key Access: Sweep > More

This function is only available when in Zero Span. The value and state is saved if Zero Span is exited and restored when Zero Span is reselected.

# View/Trace

Accesses the trace keys to store and manipulate trace information. Each trace consists of a series of points in which amplitude data is stored. The analyzer updates the information for any active trace with each sweep.

**Select Trace** Selects the trace for current use.

1234 Key access: View

continuously displays any signals during each sweep of the analyzer. This function is activated for trace 1 at power-on

and Factory Preset.

Key access: View/ Trace

Max Hold Retains the maximum level for each trace point of the

selected trace. Updates the trace point value if a new maximum level is detected in successive sweeps.

Key access: View/Trace

**Min Hold** Retains the minimum level for each trace point of the selected trace. Updates each minimum trace point if a new

minimum level is detected in following sweeps.

Key access: View

**View** Holds and displays the amplitude data of the selected trace.

The trace register is not updated as the analyzer sweeps. press **View** to retrieve a stored trace previously deactivated

by pressing **Blank**.

Key access: View Trace

**Blank** Stores the amplitude data for the selected trace, then removes the trace from the display. The selected trace register no longer updates as the analyzer sweeps. To activate this function for traces 2, 3 and 4 at power-on press

**Preset** (when **Preset Type** is set to **Factory**).

Key access: View/

4 Key Reference



Channel Power 122

Occupied BW 124

ACP 127

Intermod (TOI) 130

Spectrum Emission Mask 132

This chapter provides information on the functional descriptions of all available measurements when you press the front-panel hardkey (**Spectrum Analyzer** is selected). It is assumed that the user has an understanding of the front and rear panel, layout, and the display annotations of the analyzer. To learn more about this, refer to "Agilent N9320A at a Glance" on page 2.

### **Channel Power**

Channel Power measures the power and power spectral density in the specified channel bandwidth. A white frame on the display indicates the edge limits of the channel bandwidth. The user must specify the center frequency, reference level, and channel bandwidth to be used for the measurement.

The power calculation method used to determine the channel power is a traditional method known as the integration bandwidth (IBW) method. A swept spectrum is used as the basis for this calculation. Therefore, it is important to set the resolution bandwidth correctly before making this measurement using the following formula:

$$RBW = \frac{(k(span))}{n}$$

Where k is a value between 2 and 6 and n=461 is the number of trace points.

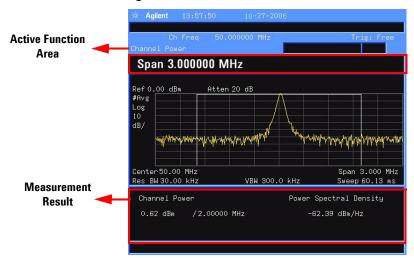


Figure 28 Channel Power Measurement

#### Avg Number On Off

Specifies the number of measurement averages used when calculating the measurement result with **Avg Number (On)**. The range is 1 to 1000. Use the knob, the arrow keys or the numeric keypad to set the number. The average will be displayed at the end of each sweep. Selecting **Off** disables measurement averaging.

Key access: Meas > Channel Power

#### Avg Mode Exp Repeat

Toggles the average mode between **Exp** or **Repeat**. This determines the averaging action after the specified number of measurements (average count) is reached.

When selecting **Exp**, each successive data acquisition after the average count is reached is exponentially weighted and combined with the existing average. Exponential averaging weights new data more than old data, which facilitates tracking of slow-changing signals. The average will be displayed at the end of each sweep.

When selecting **Repeat**, after reaching the average count, all previous data is cleared and the average count is back to 1.

Key access: Meas > Channel Power

#### Integ BW

Specifies the range of integration used in calculating the power in a channel. For example, set the main (center) channel bandwidth. Note that the white frame indicates the integration bandwidth. Be sure the span is set between 1 and 10 times the integration bandwidth. Change integration bandwidth by using the knob and the arrow keys.

Key access: Meas > Channel Power

#### Chan Pwr Span

Specifies the frequency span used for the channel power measurement by using the knob and the arrow keys. Be sure the span is set between 1 and 10 times the integration bandwidth.

Key access: Meas > Channel Power

# **Occupied BW**

Occupied Bandwidth integrates the power of the displayed spectrum. The power-bandwidth routine first computes all signal power contained in the trace, then calculates the span containing the power of the specified percentage. The percentage value default is 99% of the occupied bandwidth power.

For 99% occupied power bandwidth, Markers are placed at the frequencies on either side of 99% of the power. 1% of the power is evenly distributed outside the markers. The difference between the marker frequencies is the 99% power bandwidth.

This is the main menu of occupied bandwidth measurement including all related parameters and measurement results.

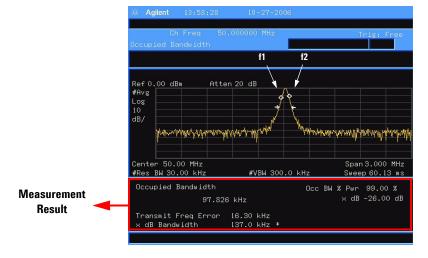


Figure 29 Occupied Bandwidth Measurement

The occupied bandwidth function also indicates the difference between the center frequency and the center frequency of the channel. This "Transmit Freq Error"

is defined as the difference between the  $(f_1 + f_2)/2$  and the tuned center frequency of the signal.

NOTE

To get the correct measurement result, first set the center frequency, reference level, and channel spacing.

#### Avg Number On Off

Select **0n** to specify the number of measurement averages used when calculating the measurement result. The average is displayed at the end of each sweep. Select **0ff** to disable measurement averaging. The range is from 1 to 1000.

Key access: Meas > Occupied BW

#### Avg Mode Exp Repeat

Toggles the termination control type used for the averaging function between **Exp** and **Repeat**. This determines the averaging action after the specified number of measurements (average count) is reached.

When you select **Exp**, each successive data acquisition after the average count is reached is exponentially weighted and combined with the existing average. Exponential averaging weights new data more than old data, which facilitates tracking of slow-changing signals. The average is displayed at the end of each sweep.

When you select **Repeat**, after reaching the average count, all previous data is cleared and the average count is reset to 1 and the averaging process is restarted.

Key access: Meas > Occupied BW

#### Max Hold On Off

Toggles the maximum hold trace feature between **On** and **Off**. Maximum hold displays and holds the maximum responses of a signal.

Key access: Meas > Occupied BW

#### Occ BW% Pwr

Edits the percentage of signal power used when determining the occupied bandwidth.

Key access: Meas > Occupied BW

#### **OBW Span**

Specifies the integration range used to calculate the total power from which the percent occupied bandwidth is then calculated. The analyzer span will be set to the same value as the OBW Span for the measurement. OBW Span should be set to an approximate multiple of 2 times the expected occupied bandwidth result. The range is from 100 Hz to 3 GHz.

Key access: Meas > Occupied BW

x dB

Specifies the power level used to determine the emission bandwidth as the number of dB down from the highest signal point, within the occupied bandwidth span. This function is an independent calculation from the OBW calculation. The x dB Bandwidth result is also called the emissions bandwidth, or EBW. Two arrows will be set to the specified dB value below the maximum power level and the total power between the arrows will be computed. Frequencies f1 and f2 are determined as the furthest frequencies x dB below and above maximum power level, respectively. The emission bandwidth is then calculated as f2 – f1 as shown by the arrows indicated in Figure 29 (note that the diamond markers are for the OBW function). The range is from –100.0 to –0.1 dB.

Key access: Meas > Occupied BW

NOTE

The asterisk next to the x dB bandwidth value in Figure 29 indicates the results may not have been determined with optimal analyzer settings. If emission bandwidth is your primary interest, select **Max Hold**. Then change detector mode to peak by pressing Pet Spelar > **Detector** > **Positive Peak**. Acquiring peak data ensures accuracy of this measurement.

### **ACP**

Adjacent Channel Power (ACP) measures the power present in adjacent transmit channels. The span is automatically set according to the six available offsets and their associated integration bandwidths as defined by the user.

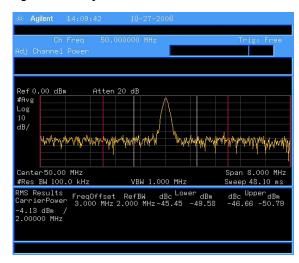


Figure 30 Adjacent Channel Power Measurement

Avg Number On Off Pressing **On** specifies the number of measurements that will be averaged when calculating the measurement result. The average will be displayed at the end of each sweep. Pressing **Off** disables the measurement averaging.

Key access: Meas > ACP

Avg Mode Exp Repeat Enables the user to select the type of termination control used for the averaging function (**Exp** or **Repeat**). This determines the averaging action after the specified number of measurements (average count) is reached.

When selecting **Exp**, each successive data acquisition after the average count is reached is exponentially weighted and combined with the existing average. Exponential averaging weights new data more than old data, which facilitates tracking of slow-changing signals. The average is displayed at the end of each sweep.

When selecting **Repeat**, after reaching the average count, all previous data is cleared and the average count is back to 1.

Key access: Meas > ACP

#### **Chan Integ BW**

Specifies the range of integration used in calculating the power in the main channel. Use the knob and the arrow keys to set the bandwidth.

Key access: Meas > ACP

#### Offset/Limits

Accesses softkeys that allow you to configure the offsets for the ACP measurement.

Key access: Meas > ACP

Offset ABCDEF Selects the offset the softkeys will affect. Press Offset until the letter of the desired offset is

underlined.

Key access: Meas > ACP > Offset/Limits

Offset Freq On Off Sets the frequency difference from the center of the main channel to the center of the offset for a maximum of 6 offsets (labeled A-F). It also allows you to turn **On/Off** the offsets that you want to measure.

Key access: Meas > ACP > Offset/Limits

**Ref BW** 

Sets the reference bandwidth (integration

bandwidth) for each offset.

Key access: Meas > ACP > Offset/Limits

Pos Offset Limit Sets the upper limit for the upper segment of the specified offset pair.

Key access: Meas > ACP > Offset/Limits

Neg Offset Limit

Sets the upper limit for the lower segment of

the specified offset pair.

Key access: Meas > ACP > Offset/Limits

#### Meas Type

Specifies the reference for the measurement, either **Total Pwr Ref** or **PSD Ref**. Relative values are displayed referenced to either the total power (**Total Pwr Ref**) or the power spectral density (**PSD Ref**) measured in the main channel.

Key access: Meas > ACP

#### Method IBW RBW

Enables you to select the measurement method. The resolution bandwidth (**RBW**) method is most useful for measuring cdmaOne signals; the integration bandwidth method (**IBW**) is preferred for other signals.

Key access: Meas > ACP > More

#### Total Pwr Ref (PSD Ref) Auto Man

Sets the adjacent channel power reference to automatic or manual when **Meas Type** is set to **Total Pwr Ref**. When select **Auto**, the carrier power result reflects the measured power value in the carrier. When set to **Man**, the last measured value is captured and held, or may be entered by the user. Relative values are displayed, referenced to the total power measured in the main channel.

When **Meas Type** is set to **PSD Ref**, pressing this key sets the power spectral density in the carrier (main channel) that is used to compute the relative power spectral density values for the offsets. When the PSD Ref state is set to **Auto**, this will be set to the measured carrier power spectral density.

Key access: Meas > ACP > More

# Limits On Off

Turns limits testing on or off. When select **On**, each offset is compared to its upper and lower offset limit. In those cases where the power exceeds the limit, the calculated result will be displayed in red to indicate a failure. If there are any failures, the pass/fail indicator area show "FAIL" in red; if there are none, it shows "PASS" in green when using IBW method. Neither "FAIL" nor "PASS" will be displayed when using RBW method. Any offsets that are in the off state are not measured and no results will be displayed.

Key access: Meas > ACP > More

# Intermod (TOI)

The third order intermodulation (TOI) measurement computes and displays the output intercept point (IP3), and places arrows upon the trace to indicate the measured signals and third-order products.

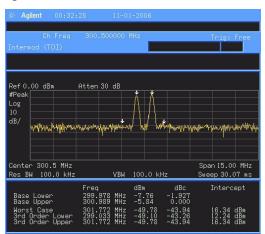


Figure 31 TOI Measurement

Avg Number On Off

Set  $Avg\ Number\ to\ On\ to\ specify\ the\ number\ of\ measurement\ averages\ used\ when\ calculating\ the\ measurement\ result.$  The average will be displayed at the end of each sweep. Setting  $Avg\ Number\ to\ Off\ disables\ measurement\ averaging.$ 

Key access: Meas > More> Intermod (TOI)

Avg Mode Exp Repeat Selects the type of termination control used for the averaging function (Exp/Repeat). This determines the averaging action after the specified number of measurements (average count) is reached.

When **Avg Mode** is **Exp**, Each successive data acquisition after the average count is reached is exponentially weighted and combined with the existing average. Exponential averaging weights new data more than old data, which facilitates tracking of slow-changing signals. The average is displayed at the end of each sweep.

When Avg Mode is Repeat, after reaching the average count, all previous data is cleared and the average count is back to 1. Key access: Meas > More> Intermod (TOI)

**TOI Span** 

Specifies the frequency span in which intermodulation products are measured. If you modify the value of span in the base instrument **Span** menu, the value in the **Intermod (TOI)** menu will be updated to reflect the new value, and the measurement will restart if it is running.

Key access: Meas > More> Intermod (TOI)

#### Max Mixer Lvl Auto Man

Sets the relationship between the highest signal that can be displayed (the reference level) and the input attenuation. The relationship applies whenever the **Attenuation** is set to **Auto**. The relationship is that the attenuation is given by reference level minus the max mixer level. For example, as the reference level changes, the input attenuator changes to ensure that a signal at the reference level does not exceed the **Max Mixer LvI** setting.

When the TOI measurement is off, the previous maximum **Max Mixer LvI** is restored.

Pressing **Auto** sets the maximum mixer level to -30 dBm.

Key access: Meas > More> Intermod (TOI)

# **Spectrum Emission Mask**

Spectrum Emission Mask measurement includes the in-band and out-of-band spurious emissions. As it applies to W-CDMA (3GPP), this is the power contained in a specified frequency bandwidth at certain offsets relative to the total carrier power. It may also be expressed as a ratio of power spectral densities between the carrier and the specified offset frequency band. For WLAN, the reference power is taken as the peak PSD in the signal, and all offset results are also the peak PSD in that offset as opposed to the integrated power.

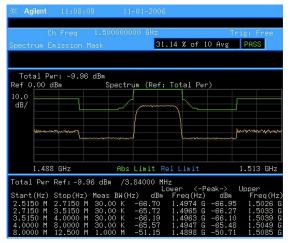


Figure 32 Spectrum Emission Mask

Avg Number On Off Set **Avg Number** to **On** to specify the number of measurement averages used when calculating the measurement result. The average will be displayed at the end of each sweep. Setting **Avg Number** to **Off** disables measurement averaging.

Key access: Meas > More > Spectrum Emission Mask

Meas Type

Displays a menu to select a measurement reference type, **Total Pwr Ref** or **PSD Ref**.

Key access: Meas > More > Spectrum Emission Mask

**Total Pwr Ref** When **Total Pwr Ref** is selected, the power in the

carrier is used as the reference in computing the relative power values for the offsets.

Key access: Meas > More > Spectrum Emission

Mask > Meas Type

**PSD Ref** When **PSD Ref** is selected, the mean power

spectral density of the carrier is used in computing the relative power spectral density

values for the offsets.

Key access: Meas > More > Spectrum Emission

Mask > Meas Type

**Ref Channel** Accesses the softkeys to change the reference channel

settings.

Key access: Meas > More > Spectrum Emission Mask

Chan Integ BW Specifies the integration bandwidth used in

calculating the power in the main channel. Key access: Meas > More > Spectrum Emission

Mask > Ref Channel

**Chan Span** Specifies the span used in measuring the

power in the main channel.

Key access: Meas > More > Spectrum Emission

Mask > Ref Channel

 $\textbf{Sweep Time} \qquad \text{Specifies the sweep time used in measuring}$ 

**Auto Man** the power in the main channel.

**Key access:** Meas > More > Spectrum Emission

Mask > Ref Channel

Res BW Auto Man

Specifies the resolution bandwidth used in measuring and the power in the main channel.

Key access: Meas > More > Spectrum Emission

Mask > Ref Channel

Total Pwr Ref (PSD Ref) Auto Man Displays the type of power measurement reference selected by **Meas Type.** 

**Total Pwr Ref** is the power in the carrier that is used as the reference in computing the relative power values for the offsets. When **Man** is selected, this can be set by the user. When **Auto** is selected, this is the measured power in the reference carrier.

**PSD Ref** is the mean power spectral density in the carrier that is used as the reference in computing the relative power spectral density values for the offsets. When **Man** is selected, this can be set by the user. When **Auto** is selected, this is the measured mean power spectral density in the reference carrier.

Key access: Meas > More > Spectrum Emission
Mask > Ref Channel

#### Offset/Limits

Displays the menus to change the following parameters for offset frequency settings and pass/fail tests: Offset, Start Freq, Stop Freq, Sweep Time, Res BW, and Limits. Refer to the tables below for default settings of particular radio standards of interest.

Key access: Meas > More > Spectrum Emission Mask

Table 1 Offsets & Limits Defaulted for W-CDMA (3GPP) Base Station Measurements<sup>a</sup>

Offset	Start Freq (MHz)	Stop Freq (MHz)	Res BW (kHz)	Abs Start (dBm)	Abs Stop (dBm)	Abs Couple	Rel Start (dBc)	Rel Stop (dBc)	Meas BW
A. On	2.515	2.715	30.00	-14.00	-14.00	Couple	-30.00	-30.00	1
B. On	2.715	3.515	30.00	-14.00	-26.00	Man	-30.00	-30.00	1
C. On	3.515	4.000	30.00	-26.00	-26.00	Couple	-30.00	-30.00	1
D. On	4.000	8.000	1000.00 30.00	-13.00	-13.00	Couple	-30.00	-30.00	1 33
E. On	8.000	12.500	1000.00	-13.00	-13.00	Couple	-30.00	-30.00	1

a. Fail Mask is set to Absolute and Rel Stop is set to Couple.

Table 2 Offsets & Limits Defaulted for W-CDMA (3GPP) Mobile Station Measurements<sup>a</sup>

Offset	Start Freq (MHz)	Stop Freq (MHz)	Res BW (kHz)	Abs Start (dBm)	Abs Stop (dBm)	Rel Couple	Rel Start (dBc)	Rel Stop (dBc)	Meas BW
A. On	2.515	3.485	30.00	-71.07	-71.07	Man	-35.23	-49.78	1
B. On	4.000	7.500	1000.0	-55.84	-55.84	Man	-35.50	-39.00	1
C. On	7.500	8.500	1000.00	-55.84	-55.84	Man	-39.00	-49.00	1
D. On	8.500	12.000	1000.00	-55.84	-55.84	Couple	-49.00	-49.00	1
E. Off	12.500	15.000	1000.00	-55.84	-55.84	Couple	-49.00	-49.00	1

a. Abs Stop is set to Couple and Fail Mask is set to Abs AND Rel.

Table 3 Offsets & Limits Defaulted for 802.11a and HiperLAN/2 Radio Standards<sup>a</sup>

Offset	Start Freq (MHz)	Stop Freq (MHz)	Abs Start (dBm)	Abs Stop (dBm)	Abs Couple	Rel Start (dBc)	Rel Stop (dBc)	Rel Couple	Meas BW
A. On	9.00	11.00	16.00	-4.00	Man	0.00	-20.00	Man	1
B. On	11.00	20.00	-4.00	-12.00	Man	-20.00	-28.00	Man	1
C. On	20.00	30.00	-12.00	-24.00	Man	-28.00	-40.00	Man	1
D. On	30.00	50.00	-24.00	-24.00	Couple	-40.00	-40.00	Couple	1
E. Off	50.00	100.00	-24.00	-24.00	Couple	-40.00	-40.00	Couple	1

a. Res BW is set to 100 kHz and Fail Mask is set to Rel.

Table 4 Offsets & Limits Defaulted for 802.11b Radio Standard<sup>a</sup>

Offset	Start Freq (MHz)	Stop Freq (MHz)	Abs Start (dBm)	Abs Stop (dBm)	Rel Start (dBc)	Rel Stop (dBc)	Meas BW
A. On	11.00	22.00	-10.00	-10.00	-30.00	-30.00	1
B. On	22.00	50.00	-30.00	-30.00	-50.00	-50.00	1
C. Off	50.00	70.00	-30.00	-30.00	-50.00	-50.00	1
D. Off	70.00	90.00	-30.00	-30.00	-50.00	-50.00	1
E. Off	90.00	100.00	-30.00	-30.00	-50.00	-50.00	1

a. Res BW is set to 100 kHz, Fail Mask is set to Rel, and Abs Stop and Rel Stop are both set to Couple.

Offset 1

Select the offset pairs (upper and lower) that the softkeys will affect, and displays the memory selection menu from A to E (the analyzer can store up to 5 sets of values for Start Freq, Stop Freq, Sweep Time, Res BW, Meas BW, Abs Start, Abs Stop, etc.). Press Offset to select the letter of the desired offset is underlined. Only one selection at a time is shown on this key label.

Key access: Meas > More > Spectrum Emission Mask > Offset/Limits

Start Freq On Off Specifies the inner limit (frequency closest to the carrier) for both segments of the specified offset pair. When **Start Freq** (**Off**) is selected, the offset pair is not measured.

Key access: Meas > More > Spectrum Emission Mask > Offset/Limits

Stop Freq

Specifies the outer limit (frequency furthest from the carrier) for both segments of the specified offset pair. The minimum frequency difference between **Start Freq** and **Stop Freq** is limited to 100 Hz.

Key access: Meas > More > Spectrum Emission Mask > Offset/Limits

Sweep Time Auto Man Specifies the sweep time for the currently selected offset, and toggles this function between **Auto** and **Manual** for each offset. Key access: Meas > More > Spectrum Emission Mask > Offset/Limits

Res BW Auto Man Specifies the resolution bandwidth used in measuring the offset pair. When set to **Auto**, the Res BW from the default tables for "Offset/Limits" on page 134 are used. When set to **Man**, the allowed range is 1 kHz to 1MHz.

Key access: Meas > More > Spectrum Emission Mask > Offset/Limits

**Abs Start** 

To enter an absolute level limit at **Start Freq** for the currently selected offset ranging from -200.00 to +50.00 dBm with 4 significant digits.

Key access: Meas > More > Spectrum Emission Mask > Offset/Limits > More

Abs Stop Couple Man To enter an absolute level limit at  $Stop\ Freq$  for the currently selected offset ranging from -200.00 to +50.00 dBm with 4 significant digits, and to toggle this function between Couple and Man. If set to Couple, this is coupled to  $Abs\ Start$  to make a flat limit line. If set to Man,  $Abs\ Start$  and  $Abs\ Stop$  the user can enter different values to make a sloped limit line.

Key access: Meas > More > Spectrum Emission Mask > Offset/Limits > More

**Rel Start** 

Enters a relative level limit at **Start Freq** ranging from -150.00 to +50.00 dBc with 4 significant digits.

Key access: Meas > More > Spectrum Emission Mask > Offset/Limits > More

Rel Stop Couple Man Enters a relative level limit at **Stop Freq** ranging from -150.00 to +50.00 dBc with 4 significant digits, and to toggle this function between **Couple** and **Man**. If set to **Couple**, this is coupled to **Rel Start** to make a flat limit line. If set to **Man**, **Rel Start** and **Rel Stop** the user can enter different values to make a sloped limit line.

Key access: Meas > More > Spectrum Emission Mask > Offset/Limits > More

Fail Mask

Displays the menu to select one of the following logic keys for fail conditions between the measurement results and the test limits: Absolute, Relative, Abs AND Rel, and Abs OR Rel.

Key access: Meas > More > Spectrum Emission Mask > Offset/Limits

> More > More

**Absolute** Sets the limit test to show Fail if one offset is

larger than the corresponding limit for  $\mbox{\bf Abs}$   $\mbox{\bf Start}$  and/or  $\mbox{\bf Abs}$   $\mbox{\bf Stop}.$  This is the default selection for

each offset for BTS measurements.

Key access: Meas > More> Spectrum Emission Mask

> Offset/Limits > More > More > Fail Mask

**Relative** Sets the limit test to show Fail if one offsets

spectrum emission mask measurement results is larger than the corresponding limit for  ${\it Rel Start}$ 

and/or Rel Stop.

**Key access:** Meas > More> Spectrum Emission Mask

> Offset/Limits > More > More > Fail Mask

Abs AND Rel Set the limit test to show Fail if one offset's

spectrum emission mask measurement results is larger than both the corresponding limit for  ${\bf Abs}$  Start and  ${\bf Abs}$  Stop and the limit for  ${\bf Rel}$  Start and

Rel Stop.

**Key access:** Meas > More > Spectrum Emission Mask

> Offset/Limits > More > More > Fail Mask

Abs OR Rel Set the limit test to show Fail if one offset's the

absolute spectrum emission mask measurement results is larger than the corresponding limit for **Abs Start** and **Abs Stop** or the limit for **Rel** 

Start and Rel Stop.

Key access: Meas > More > Spectrum Emission Mask

> Offset/Limits > More > More > Fail Mask

Meas BW

Specifies the bandwidth to use when measuring the offset. When using the front panel, only the currently selected offset is affected. All the offsets are affected when remote control. This is the multiplier applied to the resolution bandwidth to determine the bandwidth to integrate when calculating the power. Meas BW is now restricted to be 1 and not changeable.

Key access: Meas > More > Spectrum Emission Mask > Offset/Limits > More > More

Agilent N9320A Spectrum Analyzer
User's Guide

6
Instrument Messages

Overview 140

Command Errors 141

Execution Conflict 143

Device-Specific Errors 145

### **Overview**

6

If an improper operation occurs during the instrument configuration, a message will appear on the status line indicating the incident and the how the spectrum analyzer corrected the setting automatically. press Prosell > More > Show errors to read the specific descriptions of those messages.

### **Example**

In this example, a failure explanation is generally included with each error to further define its meaning. The instrument messages in this guide are listed numerically.

<Code>

-330 Self-test failed < Message>

A self-test failure occurred.

<Explanation in manual>

### **Command Errors**

The messages listed below are command errors, which are saved into local registers.

-100 Command error

An unrecognized command or data type was encountered. This message is used when the device cannot detect more specifics described for errors -101 to -109.

- -101 Invalid character
  A syntactic element contains an invalid character.
- -102 Syntax error

  An unrecognized command or data type was encountered.
- -103 Invalid separator

  The parser was expecting a separator and encountered an illegal character.
- -104 Data type error

  The parser recognized a data element that is not allowed.
- -108 Parameter not allowed

  More parameters were received than expected for the
  header. For example, the \*ESE common command only
  accepts one parameter, so receiving \*ESE 0,1 is not allowed.
- -109 Missing parameter
  Fewer parameters were received than required for the header. For example, the \*ESE common command requires one parameter, so receiving \*ESE is not allowed.
- -110 Command header error

  An error was detected in the header. This message is used when the device cannot detect more specifics described for errors -111 to -119.

#### **6** Instrument Messages

-112 Program mnemonic too long

The header contains more than 12 characters.

-113 Undefined header

The header is correct in syntax, but it is undefined for this device.

-128 Numeric data not allowed

A legal numeric data element was received, but the device does not accept one in this position for the header.

-130 Suffix error

This error is generated when parsing a suffix. This message is used when the device cannot detect more specifics described for errors -131 to -139.

-131 Invalid suffix

The suffix does not follow the syntax described in *IEEE* 488.2, or the suffix is inappropriate for the device.

-134 Suffix too long

The suffix contained more than 12 characters.

-138 Suffix not allowed

A suffix was encountered after a numeric element which does not allow suffixes.

-144 Character data too long

The character data element contains more than 12 characters.

-148 Character data not allowed

A legal character data element was encountered where prohibited by the device.

### **Execution Conflict**

The system messages listed below are execution conflicts, indicating settings conflict during your operation.

-200 Execution Error

This is the generic syntax error for devices that cannot detect more specific errors.

-222 Data out of range

A legal program data element was parsed but could not be executed because the interpreted value was outside the legal range defined by the device. The displayed results may be clipped.

-223 Too much data not all points entered

Indicates that a legal program data element of block, expression, or string type was received that contained more data than the device could handle due to memory or related device-specific requirements.

-224 Illegal parameter value

An attempt was made to select a user file that contains 0 bits. Select another user file that contains at least 1 bit.

-241 Hardware missing

Missing device hardware. For example, the RF board is not installed.

-253 Corrupt media

A source media (possibly EEPROM) for a data file is corrupt. This error is usually seen in conjunction with errors concerning a certain file.

-300 Device-specific error

This is the device-specific error for devices that cannot detect more specific errors.

### 6 Instrument Messages

- -330 Self-test failed
  A self-test failure occurred. Report this error to Agilent Technologies.
- -340 calibration failed

  An expected file was not found while trying to load internal calibration.

### **Device-Specific Errors**

- 102 Set 50 MHz signal < 0 dBm, do alignment again
  The 50 MHz energy is too high at the RF port for alignments
  to run. Reduce input power to less than 0 dBm and run
  alignments again.
- 104 1st LO Unlock

  The first LO on has lost phase lock. Report this error to the nearest Agilent Technologies sales or service office.
- 2nd LO UnlockThe second LO has lost phase lock. Report this error to the nearest Agilent Technologies sales or service office.
- 201 Option not installed

  The desired operation cannot be performed because a required option is not installed.
- The tracking generator has reached the limit of its allowable frequency range.
- 211 RBW limited to 1 kHz when Span > 1 MHz In spans greater than 1 MHz, narrow (digital) resolution bandwidths, below 1 kHz, are not available.
- 213 Span limited to 1 MHz when RBW < 1 kHz In narrow (digital) resolution bandwidths, below 1 kHz, spans greater than 1 MHz are not available.
- 214 TG start freq is less than 9 kHz

  Tracking generator uncalibrated below 9 kHz.

#### 6 Instrument Messages

215 TG start freq is less than 1/2 res bw

Tracking generator uncalibrated at start frequencies below
1/2 the current resolution bandwidth.

224 Option not licensed

The selected option requires a license. Refer to the installation procedures in the user guide provided for this particular option.

- 238 VBW filter or Average Detector cannot use both
- 501 RF over load

  Either increase input attenuation or decrease the input signal level.
- 502 IF over load

  Either increase input attenuation or decrease the input signal level.
- You attempted to save to a file that already exists. Either delete or rename the existing file or select a new name, then try again.
- 605 Media is protected

  A save was attempted to a write-protected device.
- File access is denied

  The file is protected or hidden and cannot be accessed.
- File not found

  The analyzer could not find the specified file.
- 651 Connect TG OUT to RF IN

  Attempt to align the tracking generator without its output connected. Connect the TG SOURCE to RF IN.

- 652 Connect CAL OUT to RF IN you must connect the **CAL OUT** to **RF IN** with the appropriate cable.
- While trying to load a trace or state, the state information was found to be in error. This may be because the state had been stored on a later revision of analyzer firmware. A default set of state variables was loaded instead. There is nothing wrong with the analyzer.
- 752 Unable to load state from file
  Attempt to load a state from a file failed.
- 753 Unable to save state to file
  Attempt to save a state to a file failed. See the associated error messages for the cause.
- 757 Unable to load user state

  A user preset failed, so the factory preset values were used.

  Save a valid state into user preset and try again.
- 758 Unable to save user state
  Attempt to save a user preset state failed.
- 760 Unable to query state

  Query of state over the remote interface was unsuccessful.
- 762 Unable to load file

  A failure occurred while loading a file.
- 764 Unable to save file

  Attempt to save a file failed; the file was not saved.

#### **6** Instrument Messages

767 Fatal LDS error

Attempt to initialize the instrument state has failed. Cycle instrument power. If this fails to correct the problem, contact your nearest Agilent Technologies service center.

768 Unable to load user state

Attempt to load a state failed, because the state was saved with a measurement personality that is not currently loaded. Load the appropriate personality and try again.

770 Incorrect filename

You sent a remote command to save a screen file but did not specify a valid extension.

780 No Peak Found

No signal peak was found that meets the criteria under


| Peak | > Search Criteria.

781 Video Trigger cannot be active

You sent a remote command to do one of the following:

- Turn on video trigger while the Average Detector or a Marker Function is active.
- Turn on the Average Detector or a Marker Function while Video Trigger is active.
- 782 Video Trigger cannot be used with Mkr Func

  Due to the Average Detector, the video Trigger cannot be used with Maker function.
- 783 Allowable span for current CF exceeded
- 784 Allowable CF for current span exceeded
- 805 Doing Alignment

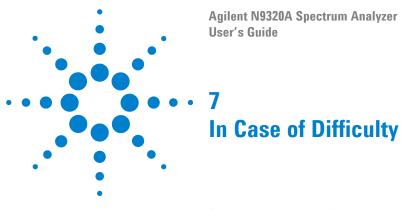

Check the Basics 150

Read the Warranty 151

Contact Agilent Technologies

This chapter includes information on how to check for a problem with your spectrum analyzer, and how to contact Agilent Technologies for service.

152

### Check the Basics

Before calling Agilent Technologies, or returning an analyzer for service, perform the quick checks listed below. This check may eliminate the problem.

- Is there power at the receptacle?
- Is the analyzer turned on? Listen for internal fan noise to determine if the analyzer cooling fan is running. Feel the rear side of the analyzer for air flow.
- If other equipment, cables, and connectors are being used with your spectrum analyzer, make sure they are connected properly and operating correctly.
- Review the measurement procedures being performed when the problem first appeared. Make sure all of the settings are correct.
- If the analyzer is not functioning as expected, return the analyzer to a known state by pressing Preset. For details, refer to "Presetting the Spectrum Analyzer" on page 27.
- Is the measurement being performed, and the results that are expected, within the specifications and capabilities of the analyzer? Refer to the *Technical Overview* for your analyzer.
- Is the analyzer displaying an error message? If so, refer to "Instrument Messages" on page 139.
- To meet specifications, the analyzer must be aligned. For more information on how to align the analyzer, refer to "Running Internal Alignments" on page 22.

### WARNING

There are no service components in the spectrum analyzer. To prevent electrical shock, do not disassemble your spectrum analyzer. Contact Agilent Technologies or professional service provider for your service.

### **Read the Warranty**

Agilent Technologies provide one year warranty as standard for your spectrum analyzer. The warranty information for your spectrum analyzer is in the back of *Technical Overview*. Please read it and be familiar with its terms.

If your spectrum analyzer is covered by a separate maintenance agreement, please be familiar with its terms.

Agilent Technologies offers several optional maintenance plans to service your spectrum analyzer after its warranty has expired. Call the nearest Agilent Technologies sales office for full details.

If you want to service the spectrum analyzer yourself after the warranty expires, you can purchase the *Service Guide* that provides all necessary test and maintenance information.

## **Contact Agilent Technologies**

Online help:	http://	/www.agilent.co	m/find/assist

United State	Canada	Europe
(tel) 800 829 4444 (fax) 800 829 4433	(tel) 877 894 4414 (fax) 800 746 4866	(tel) +31 20 547 2111
Korea	Japan	Latin America
(tel) 080 769 0800 (fax) 080 769 0900	(tel) +81 426 56 7832 (fax) +81 426 56 7840	(tel) +1 (305) 269 7500
China	Taiwan	Australia
(tel) 800 810 0189 (fax) 800 820 2816	(tel) 0800 047 866 (fax) 0800 286 331	(tel) 1 800 629 485 (fax) +61 (3) 9210 5947

#### **Other Asia Pacific Countries**

(tel) +65 6375 8100 (fax) +65 6755 0042


E-mail: tm ap@agilent.com




This chapter provides a visual representation of the front panel keys and their associated menu keys (in Spectrum Analyzer mode). Refer to Chapter 4, "Key Reference" for key function descriptions.

The name editor menu is shown separately, though it is accessed when entering data for many keys. The front-panel key menus appear in alphabetical order as follows.


# Amplitude Menu

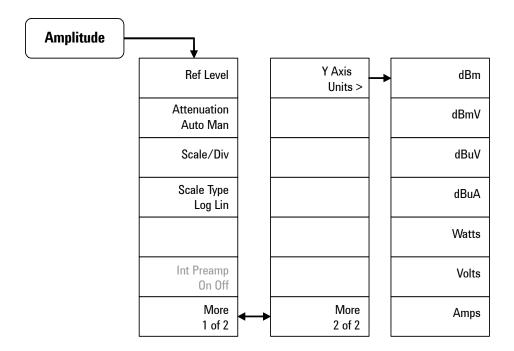


# **BW/Avg Menu**

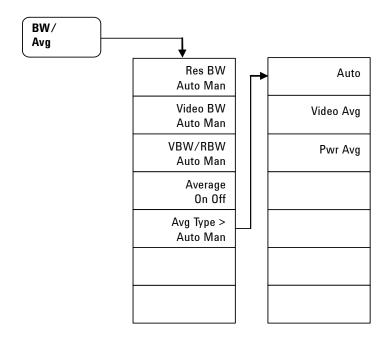


8

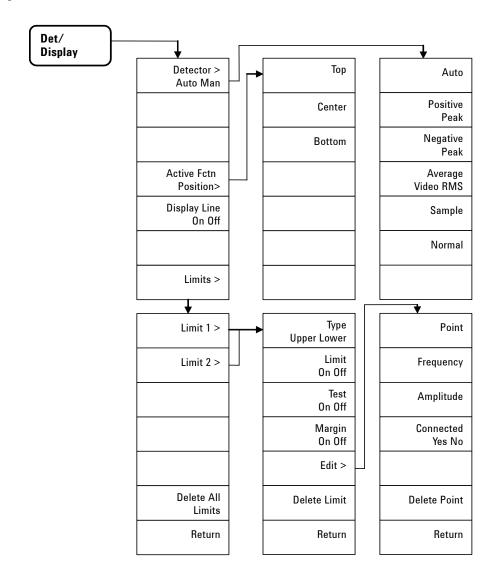

# File Menu (1 of 2)

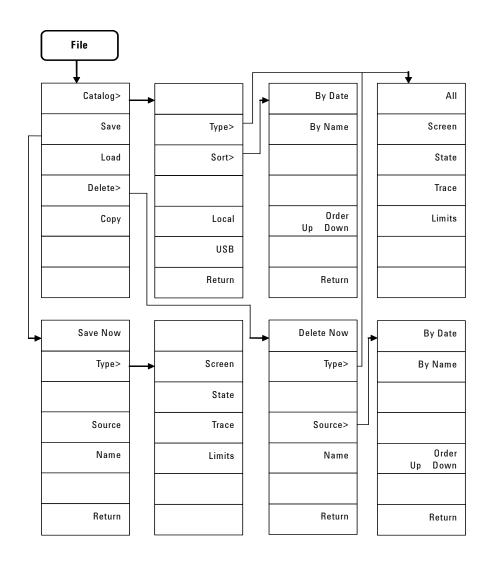


# File Menu (2 of 2)

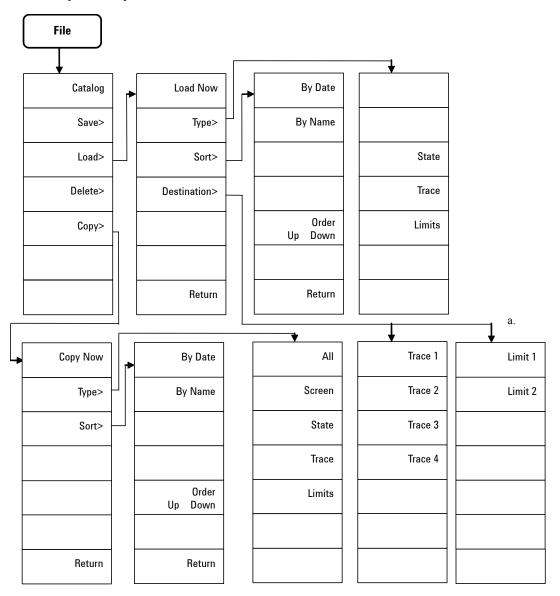


a. The path is depend on the Type selection.


# Frequency Menu

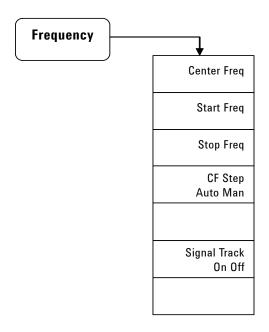


### Marker Menu

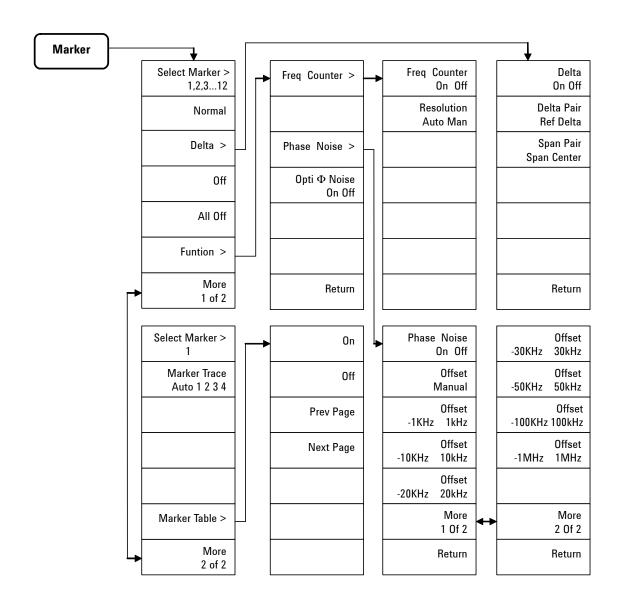

## Marker-> Menu

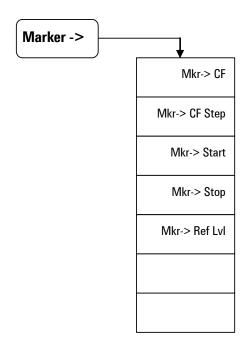


# Measure Menu (1 of 2)

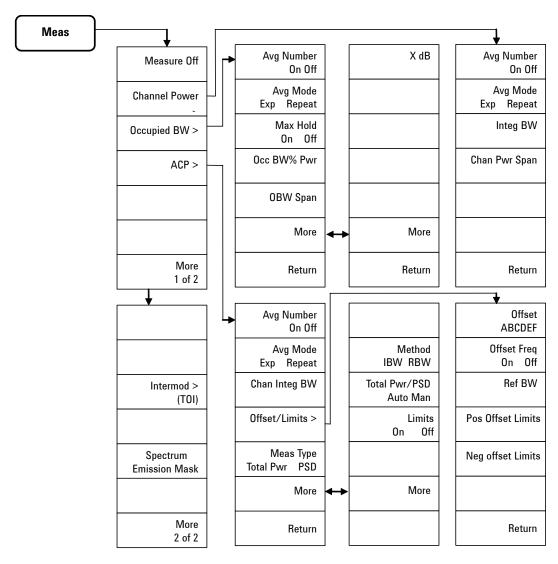


a. Continued on sheet 2 of 2

# Measure Menu (2 of 2)

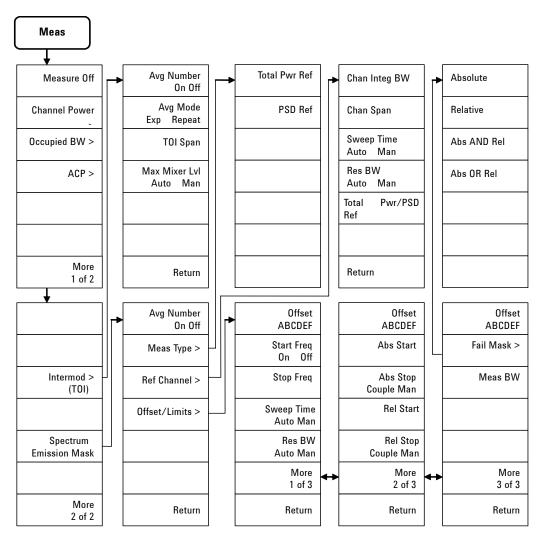


a. Links to Meas Menu (sheet 1 of 2)


## **MODE Menu**

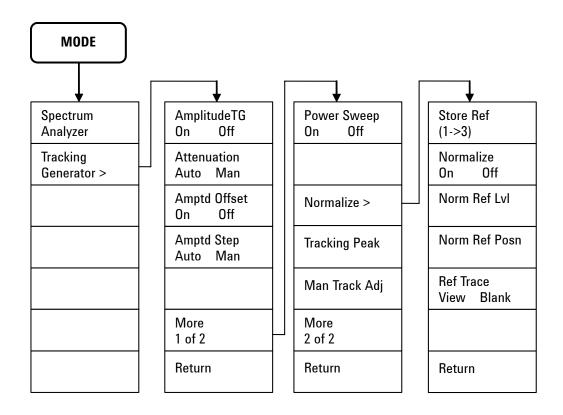


# Name editor Menu

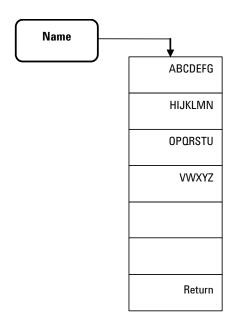


## **Peak Search Menu**

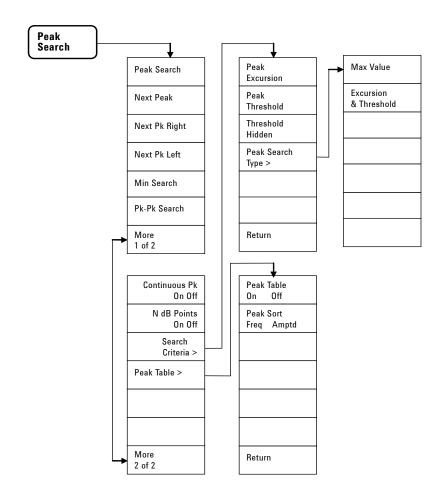


# **Preset/System Menu**

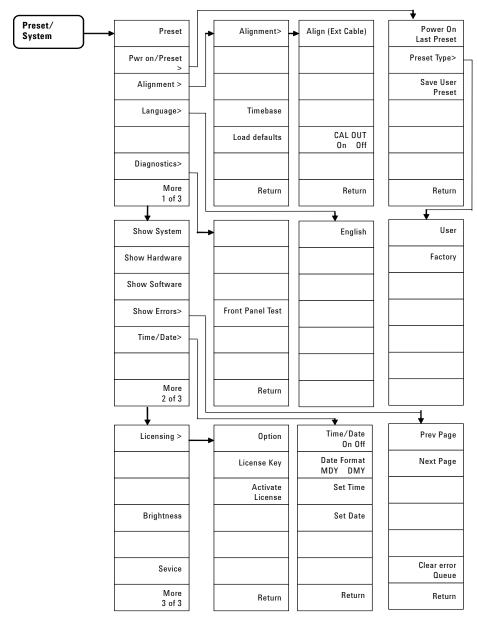


# **SPAN Menu**

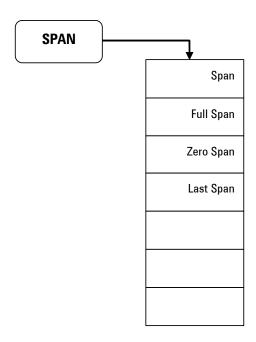

# Sweep/Trig Menu

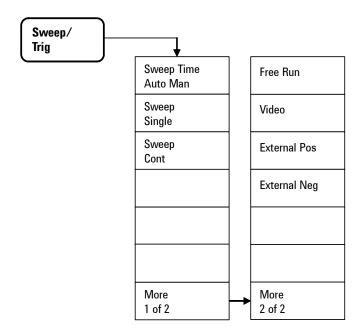

# View/Trace Menu

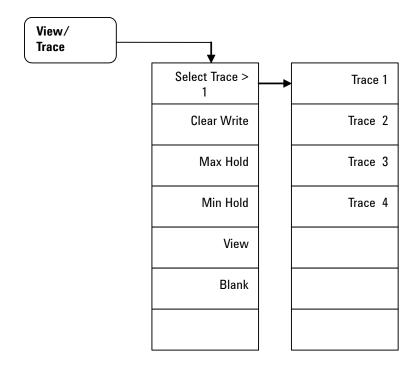

# Index

Numerics  10 MHz REF OUT, 9 3GPP W-CDMA, 134 802.11a, 135 802.11b, 136  A  Abs Start, 137 Abs Stop, 137 AC power receptacle, 9 Active Fctn Position, 83 active function, 7 adjacent channel power, 127 Agilent Technologies, contact, 152 Alignment, 113 running, 22 Amplitude key, 4, 72 annotation, marker, 29 annotations, display, 7 Attenuation, 72 attenuation, reducing, 39 Auto Tune key, 5, 75	channel power, 122 comparing signals   off screen, 32   on the screen, 30 connector   CAL OUT, 6   EXT TRG IN, 9   PROBE POWER, 6   REF IN, 9   REF OUT, 9   RF IN, 6   TG SOURCE, 6   USB, 6, 9   VGA, 9 Continuous PK, 108 Copy, 93 CSA mark, 10 c-tick mark, 10  D Data control keys, 6 Delete, 92 delta marker, 97	factory preset state, 112 Fail Mask, 137 File key, 88 File/Print key, 5 firmware revision, update, 23 frequency counter, 99 Frequency key, 4 front panel display annotations, 7 overview, 4 symbols, 10 front panel, using, 26  H harmonic distortion measuring, 48  I improving frequency resolution and accuracy, 44
Average, 78	Det/Display key, 5, 81 Detector, 81 Display, 7	instruction manual, 10 instrument messages, 139 Int Preamp, 73
Back, 76 BW/Avg key, 5, 77	Display, 7 Display Line, 83 distortion, measuring, 48	IO libraries suite, 24 ISM1-A, 10
CAL OUT connector, 6 Catalog, 88 CE mark, 10 Center Freq, 95 CF Step, 95	Enter key, 87 error message, 21 ESD, 19 EXT TRG IN(TTL), 9 external reference, 22, 23	L LAN, 9 Licensing, 115 Limits, 84 Load, 91 Local, 5 lock, 9

N9320A User's Guide


### Index

M	power receptacle, 9	switch
Marker key, 5, 97	power requirements, 13	power, 9
Marker Table, 100	power switch, 9	standby, 6
Marker-> key, 5, 101	Preset, 111	symbols, 10
	preset	
Max Mixer IVI, 131	factory, 27	T
Meas key, 5, 102, 121	user, 27	TG SOURCE connector, 6
measuring	Preset/System key, 5, 111	Threshold Hidden, 109
ACP, 127	PROBE POWER, 6	TOI
channel power, 122	Pwr on/Preset, 113	
distortion, 48		Meas key, 130
low-level signal, 39	R	measuring, 51
multiple signals, 30		TOI Span, 131
occupied BW, 124	rack mount, 16	tracking drifting signals, 46
SEM, 132	rear panel overview, 9	
source's frequency drift, 46	REF IN, 9	U
TOI, 51, 130	Ref level, 72	Uncoupled, definition, 42
measuring phase noise, 54	REF OUT, 9	USB
menu maps, 153	Rel Start, 137	DEV, 9
messages, 21	Rel Stop, 137	host, 9
Min Search, 107	remote control, 24	using frequency counter, 44
MODE key, 5, 103	requirements	3 1 /
	ventilation, 15	V
N	Res BW, 77	•
N dB Points, 108	resolving signals	VBW/RBW, 77
Next Peak, 107	equal amplitude, 34	ventilation, 15
Troke Found, 107	hidden by large signals, 37	VGA, 9
0	RF IN connector, 6	Video BW, 77
•		View/Trace key, 5, 120
occupied BW, 124	S	viewing signal, 28
Offset/Limits, 128, 134	C 00	
options, 12	Save, 89	W
enable, 22	Scale/Div, 72	WEEE 10
licensing, 115	Search Criteria, 108	WEEE, 10
TG3, 6	Show System, 114	
order list, 12	Signal Track, 96	
	softkeys, 4	
P	SPAN key, 4, 117	
Dook Coards have E 107	spectrum emission mask, 132	
Peak Search key, 5, 107	standby switch, 6	
Peak Table, 110	Start Freq, 95	
Phase Noise, 99	Stop Freq, 95	
phase noise, measuring, 54	Sweep/Trig key, 5, 118	
power cord, 13		

N9320A User's Guide



### **DECLARATION OF CONFORMITY**

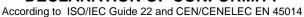



Manufacturer's Name: Agilent-Qianfeng Electronic Technologies (Chengdu) Co., Ltd

Manufacturer's Address: Qianfeng Hi-Tech Industry Park,

Chengdu Hi-Tech Industrial Development Zone (West District),

Chengdu, 611731 P.R.C.

Declares under sole responsibility that the product as originally delivered

Product Name: Spectrum Analyzer

Model Number: N9320A

**Product Options:** This declaration covers all options of the above product(s)

complies with the essential requirements of the following applicable European Directives, and carries the CE marking accordingly:

Low Voltage Directive (73/23/EEC, amended by 93/68/EEC) EMC Directive (89/336/EEC, amended by 93/68/EEC)

#### and conforms with the following product standards:

EMC	Standard	Limit	
	IEC 61326-1:1997+A1:1998 / EN 61326-1:1997+A1:1998		
	CISPR 11:1990 / EN 55011:1991	Class A Group 1	
	IEC 61000-4-2:1995+A1:1998 / EN 61000-4-2:1995	4 kV CD, 8 kV AD	
	IEC 61000-4-3:1995 / EN 61000-4-3:1995	3 V/m, 80-1000 MHz	
	IEC 61000-4-4:1995 / EN 61000-4-4:1995	0.5 kV signal lines, 1 kV power lines	
	IEC 61000-4-5:1995 / EN 61000-4-5:1995	0.5 kV line-line, 1 kV line-ground	
	IEC 61000-4-6:1996 / EN 61000-4-6:1996	3 V, 0.15-80 MHz	
	IEC 61000-4-11:1994 / EN 61000-4-11:1994	1 cycle/ 100%	
	Canada: ICES-001:1998		
	Australia/New Zealand: AS/NZS 2064.1		
	This product was tested in a typical configuration with Agilen	s tested in a typical configuration with Agilent Technologies test systems.	
Safety	IEC 61010-1:2001 / EN 61010-1:2001		
	Canada: CSA C22.2 No. 61010-1:2004		
	USA: UL 61010-1: 2004		

#### Supplementary Information:

This DoC applies to above-listed products placed on the EU market after:

Nov 16, 2006

Date

Shi Wen

Quality Manager

For further information, please contact your local Agilent Technologies sales office, agent or distributor, or Agilent Technologies Deutschland GmbH, Herrenberger Straße 130, D 71034 Böblingen, Germany.

### www.agilent.com

© Agilent Technologies, Inc. 2006-2008

Printed in China Second Edition, May 2008



N9320-90001

